

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 2N , R 36E. , W.M.

Corner Code No. A-3

Notes: Monument marked as shown below

History of original corner establishment:

This corner was originally established by Currin and Noland, U.S. Deputy Surveyors, under Special Instructions dated May 4, 1887. In 1919, C.E. Redfield, Surveyor for the U.S. Indian Service, re-established the corner.

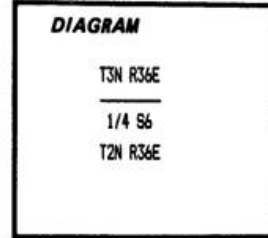

Corner No. Compass Declination: 19.0

Description of corner evidence found:

None. Corner area has been disturbed by the movement of Meacham Creek.

Description of monument and accessories established to perpetuate the original location of this corner:

Re-established corner by single proportion measure between recovered corners East and West of the Corner. Utilized Redfield's 1919 record for proportioning.

At the re-established corner position, set a 5/8 by 30" iron pin with 1 1/2" aluminum cap marked as follows:

PLS 1106

1/4 S 6
T2N R36E

Marked bearing tree accessories as follows:

A 9" ponderosa pine bears S 31 W 54.0', scribed 1/4 S6 BT.
A 18" ponderosa pine bears S 13 E 29.3', scribed 1/4 S6 BT.
A 9" ponderosa pine bears N 45 E 51.8', scribed X BT at base.
A 8" ponderosa pine bears N 67 E 44.7', scribed X BT at base.

Attached bearing object signs to each of the bearing trees.

Bearings to bearing trees were measured with a hand compass. Distances were taken to the center of the trees.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of Survey Dept. County of Umatilla
State of OR I hereby certify that the within instrument was filed in this office for record on the 7th day of June 1990
David H. Kaumder (COUNTY OFFICIAL) by Kathleen K. Amstrong (DEPUTY)

RECEIVED BY Umatilla County Surveyor

Date 6-90
90-42-C

OREGON CORNER RESTORATION FORM

CORNER NO: A-3

Section 6 Township 2N Range 36E

County UMATILLA Date 10-25-90

CORNER DESIGNATION

1/4 S 6
T 2 N R 36 E

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc. CORNER LAST ESTABLISHED BY
C.E. REDFIELD IN 1919.

Monument(s) & Accessories Found: (Condition and Source)

NONE. THE REDFIELD MONUMENT HAS BEEN DESTROYED
BY MOVEMENT OF THE MEACHAM CREEK CHANNEL.

Monument Detail

SET 5/8" X 30" IRON PIN WITH 1/2"
ALUM. CAP 24" IN THE GROUND
AND SURROUNDED WITH A STONE
MOUND. CORNER IS LOCATED
5' EAST OF THE PRESENT ERODED
EAST BANK OF MEACHAM CREEK.

Sketch
CAP MARKED



Monument Set (Procedures and Description)

RE-ESTABLISHED CORNER BY SINGLE PROPORTION MEASURE
BETWEEN THE SOUTH 1/4 AND EAST 1/16TH CORNER ON
THE SOUTH LINE OF SECTION 31, T 2 N R 36 E, W.M.,
USING THE C.E. REDFIELD RECORD.

New Accessories

A 9" PONDEROSA PINE BEARS S 31° W - 4.0' SCRIBED 1/4 S 6 BT.
A 18" PONDEROSA PINE BEARS S 13° E - 29.3' SCRIBED 1/4 S 6 BT.
A 9" PONDEROSA PINE BEARS N 45° E - 51.8' SCRIBED X BT.
A 8" PONDEROSA PINE BEARS N 67° E - 44.7' SCRIBED X BT.
ATTACHED BEARING OBJECT SIGNS TO BEARING TREES.

Location & Comments

Surveyor's Seal

Compass Declination 19°
Firm/Agency William R.
WELLS, PLS
Address P.O. Box 1696

REGISTERED
PROFESSIONAL
LAND SURVEYOR

RECEIVED BY

Umatilla County Surveyor

Date 6-90

Rec'd By AF

No. 90-42-B

PENDLETON, OR 97801

Party Chief BILL WELLS

Notes

Witness BILL QUAMPS

Will - R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106