

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 04/14/17.

CORNER DESIGNATION: J-7, The North one-quarter corner of Section 17, Township 2 North, Range 28 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner originally established by David P. Thompson Contract No. 83 dated July 22, 1859. Notes state: Set post corner for 1/4 Sec. corner in mound of earth & as per instructions.

MONUMENT AND ACCESSORIES FOUND: Old established fence corner with fences extending East and South.

CORNER IDENTIFICATION:

T2N R28E
S8
1/4 -----
S17

MONUMENT SET: Held the fence corner as best remaining evidence of the original corner location. Attempted to set a brass cap monument but hit a 4" buried irrigation pipe 12" below ground. At the corner point, set a 5/8 by 30" rebar with red plastic cap marked "OR PLS 1106 WA PLS 17372", just North of railroad tie fence corner post.

New accessories:

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears S 88 1/2° E, 23.3 feet.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears S 88 1/2° E, 53.8 feet.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears South, 29.6 feet.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears South 48.9 feet.

The red plastic caps are marked "ORPLS 1106 WAPLS 17372". All rebar accessories are set in the existing fence lines and have "bearing object" signs wired to them. Nailed a "Witness" sign to a wood fence post just South of corner monument..

LOCATION AND COMMENTS: Corner is located at a fence corner with fences extending East and South.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801


COMPASS DECLINATION: 18° East

Surveyor's Seal

\2N28J7



William R. Wells

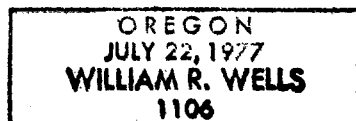

renews 6-30-18