

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 01/19/06

CORNER DESIGNATION: 2N31, J-23, The North One-Quarter Corner of Section 13.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner established by Josiah A. Burnett, under Contract No. 92, dated September 12, 1860. Record states: Set a post for 1/4 Sec. corner, drove charred stake and raised mound with trench, as per instructions.

Corner was recovered in survey recorded in Book 1, Page 359. Notes do not state what was recovered.

A 2" axle shaft is noted at the corner point in Survey No. Q-78-B. All recent surveys have accepted this axle shaft as the corner point.

MONUMENT AND ACCESSORIES FOUND:

Found 2" dia. axle shaft firmly set, protruding 2" in a mound of stone on rocky hillside, with fences running North, South, and East. Traces of an old fence running West were also observed. I did not replace the existing axle shaft monument.

From the existing axle shaft:

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears North, 32.3 feet, near fence.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears South, 59.7 feet, near fence.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears South 17° West, 79.1 feet, near fence.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears North 25° West, 34.5 feet.

Attached bearing object signs to all rebar accessories. Attached witness sign to sawn off power pole 1 foot from corner monument.

LOCATION AND COMMENTS:

Corner is located at a fence corner with fences North, South, and East.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 730938.82

E = 8615872.48


FIRM: William R. Wells, PLS
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

/2N31J23

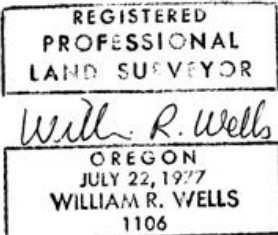

renews 6-30-08

06-462-c