

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

T 2N, R 32E., W.M.

Corner Code No. J-9

Note: Monument marked as shown below

**History of original corner establishment:**

Corner was originally established by Daniel Chaplin, U.S. Deputy Surveyor, under Contract No. 107, dated September 21, 1864.

Z. F. Moody, U.S. Deputy Surveyor, in Contract No. 164, dated October 4, 1871, established a new corner. This new corner superceded that corner established under Contract No. 107.


Currin and Noland, U. S. Deputy Surveyors, under Special Contract dated May 4, 1887, recovered Moody's corner and re-monumented it with a witness corner.

County Surveys No. 65 and 71, by John Kimbrell in 1894 and 1895 make ties to the corner as re-monumented by Currin and Noland.

Survey No. D-4, in 1967, incorrectly re-established this corner, by double proportion measure, using Chaplin's 1864 record.

Since 1967, a number of surveys have used the incorrectly positioned monument from Survey No. D-4.

Note: Survey and subdivision of Section 9, by the City of Pendleton in map dated 3/23/54, (City Map No. B-54-21-M) shows this corner being re-established and re-monumented by unknown methods. (No. 89-121-B).

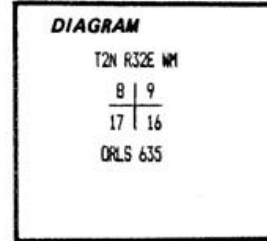

Corner No.  
Compass Declination: 18.0

**Description of corner evidence found:**

Monument by LS 635, re-established using improper original record, in Survey No. D-4.

The monument shown as established for the corner by City of Pendleton survey map dated 3/23/54 was not recovered after extensive search. This monument would have been located in a North-South fenceline about 53' West of the monument by LS 635.

**Description of monument and accessories established to perpetuate the original location of this corner:**

Note: The monument established in Survey No. D-4, and later used on a number of private surveys in the area was established by double proportion measure using the improper original record. It's in the wrong place! Re-establishment of the proper position of the corner, based on the approved original record, will require considerable research and retracement measurement and is beyond the scope of my Contract with the County. Since the location of this improperly positioned monument must be preserved since surveys have been made from it, I have referenced it as noted below. However, I accept no responsibility for this improperly located monument.

Monument as established in Survey No. D-4, is a 2 1/2" brass cap in a 2' square concrete pad, located in a pasture. There is an east-west fence 66' north and a north-south fence 53' to the west. From the monument:

A brass washer stamped "PLS 1106", nailed to the South side of a 10" hawthorn tree, 1' above ground, bears S 55° E 23.85'.

A brass washer stamped "PLS 1106", tacked to the Northwest corner of a shed, 2' above ground, bears S 23° W 120.8'.

A brass washer stamped "PLS 1106", nailed to the South side of a railroad tie fence corner, 1' above ground, bears N 39° W 84.13'.

A brass washer stamped "PLS 1106", nailed to the South side of a wood fence post, 1' above ground, bears N 28° E 74.68'.

The brass cap on the monument is stamped as shown in the corner diagram.

REGISTERED PROFESSIONAL LAND SURVEYOR
<i>William R. Wells</i>
OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of Survey Dept County of Umatilla

State of OR, I hereby certify that the within instrument was filed in this office for record on the 19th day of July, 1990

David H. Krambs by Kathleen J. Johnson

(COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY

Form R6-7100-57 (9/71)

Umatilla County, Oregon  
Date 7-90  
Rec'd by KA  
No. 90-58-C

☆GPO: 1989-692-949