

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/14/94

CORNER DESIGNATION: V-17. Northeast corner Section 34, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Most recent approved GLO Survey was made by James P. Currin and James Noland, under Special Contract dated May 4, 1887. They found old corner and re-established. Set stone 15 x 10 x 7 ins., 10 inches in the ground, marked with 2 notches on E. and 1 on S. edges. Redug pits 18 x 18 x 12 ins., in each section, 5 1/2 ft. distant and raised a mound of earth 2 ft. high, 4 1/2 ft. base alongside. Corner was re-established by PLS 933 as shown on Umatilla County Survey No. R-98-C.

MONUMENT AND ACCESSORIES FOUND: Found 2 1/2" brass cap on galvanized iron pipe, set flush with the ground, as established in Umatilla County Survey No. R-98-C.

MONUMENT MARKING DETAIL:

T2N	R32E
S27	S26
S34	S35
1980	
PLS 933	

MONUMENT SET: Maintained Corner. Built a small mound of stone around monument. Attached witness sign to 9" round corner post 0.3 feet South of monument.

New Accessories:


A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 89 1/2° E- 33.7 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 3° E- 16.4 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 3 1/2° W- 23.9 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 87° W- 22.0 feet.
Attached bearing object signs to each iron pin. Set steel fence posts near iron pins with witness signs attached.

LOCATION & COMMENTS: Corner falls in a fence intersection on East side of knob, East of Lakeview Drive. Fences extend East-West and South.

COMPASS DECLINATION: 18° East.
FIRM/AGENCY: William R. Wells, PLS
P.O. Box 1696
Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scot Munro

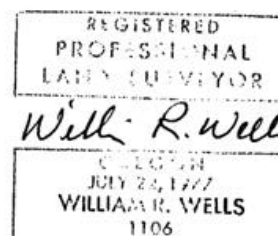

renewals 12-31-94