

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 2N, R 33E., W.M.

Corner Code No. N-19

Note: Monument marked as shown below

History of original corner establishment:

This corner was last re-established by C.E. Redfield, U.S. Indian Service Surveyor, during his surveys in the area between 1917 and 1920. Redfield indicates a stone at the corner.

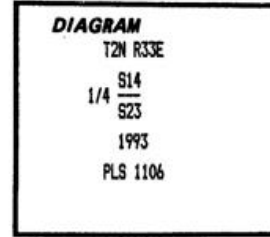

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Farming has removed all evidence of original corner.

Re-established corner by single proportion measurement between the recovered Southeast corner of Section 14 and the re-established Southwest corner of Section 14.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2 1/2" brass cap on 1 1/4" by 30" galvanized iron pipe with top of pipe buried 12" below ground surface.

Bearing Objects to corner:

- A 5/8" by 30" iron pin bears N 86°W - 29.1', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 5/8" by 30" iron pin bears S 87°E - 34.4', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 1/2" by 15" iron pin bears S 38°W - 36.6'.
- A 1/2" by 15" iron pin bears N 47°E - 34.0'.

All pins have a Bearing Object sign wired on, and are buried with top of pin at least 12" below ground surface.

Set an 8' steel fence post 1.3' East of monument, and attached a Witness Corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12-31-94

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

93-53-c