

R-15


History of original corner establishment:

Corner originally established by George S. Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12, 1881.

Surveyor General records state:

Set tamarack post on slope for 1/4 Sec. Cor.

A tamarack 12 in. di. brs. S4°W, 27 chs. dist.
A fir 13 in. di. brs. N24°W, 14 lks. dist.

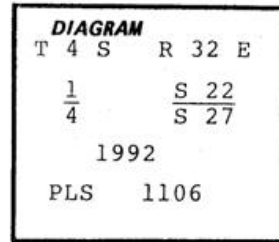

Description of corner evidence found:

Found rotted remains of a 22" douglas fir stump brs N24°W, 14 lks (9.2'). Remains of blaze face & fragmentary scribes & axe marks were found at base of stump. The stump is very rotten.

Description of monument and accessories established to perpetuate the original location of this corner:

Re-established corner by reversing record call, measuring to where blaze face would have stood.

Set a 2 1/2" x 30" aluminum pipe with 2 1/2" aluminum cap 26" in ground surrounded with mound of earth only and set steel fence post East of corner and attached signs 54-2 & 54-9. Cap marked as shown in corner diagram.

New BT's established:

- A 15" western larch brs N50 1/2°W, 20.1' scribed 1/4S22 BT.
- A 10" western larch brs N39 1/2°E, 20.0' scribed 1/4S22 BT.
- A 11" western larch brs S85 1/2°W, 44.8' scribed 1/4S27 BT.
- A 12" western larch brs S63°E, 25.9' scribed 1/4S27 BT.

New BT's have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 18° East.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on June 04, 1992.



Office of County Surveyor County of Umatilla
Oregon I hereby certify that the within instrument was filed in this office
 for record on the day of , 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

R-15

RECEIVED BY

Umatilla County Surveyor ★ OPO-788-276

Date _____

Rec'd By _____

No. 92-80-B

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-15


History of original corner establishment:

Corner originally established by George S. Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12, 1881.

Surveyor General records state:

Set tamarack post on slope for 1/4 Sec. Cor.

A tamarack 12 in. di. brs. S40W, 27 chs. dist.
A fir 13 in. di. brs. N24W, 14 lks. dist.

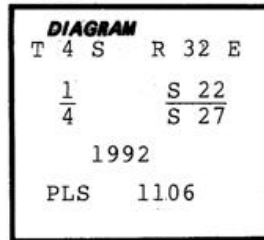

Description of corner evidence found:

Found rotted remains of a 22" douglas fir stump brs N24W, 14 lks (9.2'). Remains of blaze face & fragmentary scribes & axe marks were found at base of stump. The stump is very rotten.

Description of monument and accessories established to perpetuate the original location of this corner:

Re-established corner by reversing record call, measuring to where blaze face would have stood.

Set a 2 1/2"x30" aluminum pipe with 2 1/2" aluminum cap 26" in ground surrounded with mound of earth only and set steel fence post East of corner and attached signs 54-2 & 54-9. Cap marked as shown in corner diagram.

New BT's established:

- A 15" western larch brs N50 1/2 W, 20.1' scribed 1/4S22 BT.
- A 10" western larch brs N39 1/2 E, 20.0' scribed 1/4S22 BT.
- A 11" western larch brs S85 1/2 W, 44.8' scribed 1/4S27 BT.
- A 12" western larch brs S63 E, 25.9' scribed 1/4S27 BT.

New BT's have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 18° East.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on June 04, 1992.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of County Surveyor County of Umatilla
Oregon
State of I hereby certify that the within instrument was filed in this office
for record on the day of 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

R-15

Form R6-7100-57 (9/71)

RECEIVED BY
Umatilla County Surveyor
Date 7-92
Rec'd By KK
No. 92-80-B

★ OPO-798-276