

OREGON CORNER RESTORATION FORM

Section 18 Township 3N
County Umatilla Date: 03/14/11

Range 33E

Corner Designation: 3N33L1

1/4 corner common to sections 18, T3NR33E, 13,
T3NR32E.

_____	Condition Report Only
X _____	Not Found
_____	Remonumented
_____	Unrecorded
X _____	Surveyed In
X _____	Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by Thompson in 1864. He set a post in a mound of earth.
Moody set a post in a mound of earth in 1871.


Monuments and Accessories Found: (Condition and Source)

None.

Diagram

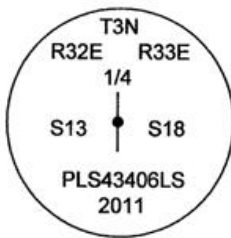

Sketch

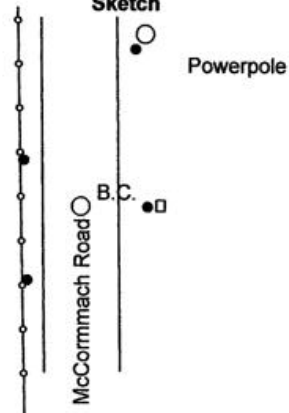

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N760659.99
E8650043.58

Monument (s) Set (Procedures and Description)

Set a 1 1/8" x 30" galvanized iron pipe with a 2 1/2" brass cap, 15" below surface, held post at field line for Northing and North-South line for alignment, stamped as shown above.

References Set:

- A 5/8" Iron rebar w/rpc #43406, lies N 8°40' E, 147.43'. At a powerpole.
- A 5/8" Iron rebar w/rpc #43406, lies East, 24.69'.
- A 5/8" iron rebar w/rpc #43406, lies S 38°45' W, 16.44'.
- A 5/8" iron rebar w/rpc #43406, lies N 30° W, 21.35'.

Location and Comments

From the intersection McCormach Rd. and Fulton Rd. go 0.5 miles North.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/11

RECEIVED BY:

Date: _____
Rec'd By: _____
No. _____

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055