

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 10/05/18.

CORNER DESIGNATION: J-7, The South 1/4 corner of Section 8, Township 4 North, Range 33 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner was originally established by Odell and Lewis, Deputy Surveyors, under Contract No. 110, dated February 7, 1865. Notes state:

Set 1/4 Sec. post. Drove charred stake. Dug pits and raised mound as per instructions.

MONUMENT AND ACCESSORIES FOUND: None. Reestablished corner point at the intersection of centerline of Myrick Road (North-South) and field berms extending West and East.

MONUMENT MARKING DETAIL:

T4N R33E
S8
1/4 -----
S17
2018
PLS 1106

MONUMENT SET: Set a 2" aluminum cap on 5/8 by 24" rebar with aluminum cap 8" below road surface for corner. Cap marked as shown in Monument Marking Detail.

New accessories:

A brass washer stamped "PLS 1106", nailed to the East side of Pacific Power Pole No. 0850, 1' above ground line bears N 16° E, 141.3'.
A brass washer stamped "PLS 1106", nailed to the East side of Pacific Power Pole No. 08400, 1' above ground line bears N 08° W, 161.0'.
The base of a bent steel fence post protruding from a concrete culvert structure bears S 06 1/2° E, 160.6'.
A 5/8" by 24" rebar with red plastic cap bears S 88 1/2° W, 22.2'.


Red plastic cap is marked "ORPLS 1106 W/APLS 17372". All rebar accessories have "bearing object" signs wired to them. Nailed "bearing object" signs to the power poles with brass washer accessories.

Wired "Witness" sign to old steel fence post just East of rebar accessory.

LOCATION AND COMMENTS: Corner is located at the intersection centerline of Koebecke Road and field berms extending South. The Easterly berm begins East of an existing residence.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

Surveyor's Seal

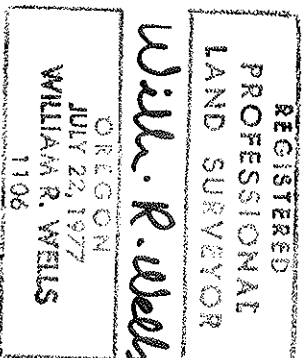

Renews 6-30-20

RECEIVED BY
Umatilla County Surveyor
Date: 10/11/2018
Rec'd By: TMA
No.: 18-087-R

IAN33J-7