

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla. DATE: 10/02/18.

CORNER DESIGNATION: L-1, The West 1/4 corner of Section 18, Township 4 North, Range 33 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner was originally established by Odell and Lewis, Deputy Surveyors, under Contract No. 110, dated February 7, 1865. Notes state:

Set 1/4 Sec. post. Drove charred stake. Dug pits and raised mound as per instructions.

MONUMENT AND ACCESSORIES FOUND: None. Reestablished corner point at the intersection old fence extending North and field line and berm extending East.

**MONUMENT MARKING DETAIL:**

T4N  
1/4  
R32E S13 | S18 R33E  
2018  
PLS 1106

MONUMENT SET: Set a 2" aluminum cap on 5/8 by 24" rebar with aluminum cap 8" below road surface of road in sweeping road curve for corner. Cap marked as shown in Monument Marking Detail.

**New accessories:**

- A 5/8" by 24" rebar with red plastic cap bears N 37° W, 35.0'.
- A 5/8" by 24" rebar with red plastic cap bears N 03° W, 26.1'.
- A 5/8" by 24" rebar with red plastic cap bears S 67° E, 32.4'.
- A 5/8" by 24" rebar with red plastic cap bears S 35° E, 50.8'.

Red plastic caps are marked "ORPLS 1106 WAPLS 17372". All rebar accessories have "bearing object" signs wired to them.


Attached "Witness" sign to steel fence post beside rebar accessory bearing N 03° W from the corner.

LOCATION AND COMMENTS: Corner is located at the intersection and old fence extending North and a field berm extending East. The corner is about 5' North of the visual road centerline in a curve.

FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

Surveyor's Seal

IAN33L-1

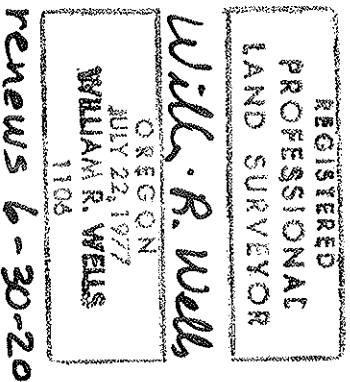

*renews 6-30-20*

**RECEIVED BY**  
 Umatilla County Surveyor  
 Date: 10/11/2018  
 Rec'd By: TMA  
 No.: 18-087-R