


CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner originally established by George S. Pershin under GLO contract number 430, dated 1882. Surveyor General record states: Set a post 4 ft. long 4 ins square 24 ins in ground for cor to secs 2, 3, 10 & 11 marked T5S S2 on NE, R30E S11 on SE, S10 on SW and S3 on NW faces with 5 notches on S and 2 notches on E edges; from which:
 A tamarack 12 ins dia brs N61°E, 61 lks dist marked T5S R30E S2 BT. A tamarack 24 in dia brs S47°W, 29 lks dist marked T5S R30E S10 BT. A tamarack 20 in dia brs N46°W, 37 lks dist marked T5S R30E S3 BT. A fir 12 in dia brs S50°E, 10 lks dist marked T5S R30E S11 BT.

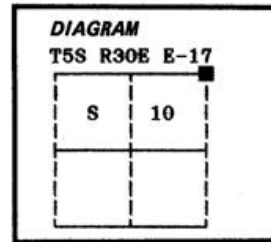

Corner remonumented in 1974 by Duane I. Griffith, OPLS 644. His monumentation record states: Found original BTs as follows: A 8" Tamarack snag bears N29°E, 40.0 ft., scribes visible. A 17" Fir snag bears S75°E, 6.6 ft., blaze healed. A 30" Tamarack, good condition, bears S28°W, 22.7 ft., scribes visible. A 32" Tamarack, good condition, bears N53°W, 24.4 ft., scribes visible. At corner point, based on record distance to BTs, I set 2½"x30" iron pipe with brass cap marked (shown below), 24" in ground, from which: New BTs A 13" Fir bears N41°E, 67.0 ft. marked T5S R30E S2 BT. A 12" Fir bears S59°E, 68.5 ft. marked T5S R30E S11 BT. Set steel fence post 5+/- ft. South and 5+/- East of corner.
 Description of corner evidence found: | No record of subsequent monumentation found in Umatilla County survey records.

Found a 2½ inch brass cap monument marked as shown below, in a mound of stone.
 Found a 8 inch diameter Tamarack N29°E, 40.0 feet, dead and down with scribes visible.
 Found a 14 inch diameter Douglas Fir N41°E, 67.0 feet, live and vigorous with scribes visible.
 Found a 17 inch diameter Douglas Fir snag S75°E, 6.6 feet with blaze evident. (I did not open).
 Found a 22 inch diameter Tamarack S28°W, 22.7 feet, live and vigorous with scribes visible.
 Found a 24 inch diameter Tamarack N53°E, 24.4 feet live, not healthy, with scribes visible.
 Found steel fenceposts approximately 5 feet East with property boundary sign and approximately 5 feet South with property boundary and attention signs attached.
 Distance to the original BTs are to the face of the blaze, and distances to the subsequent BTs are to the center of the tree.

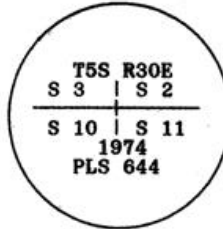

Description of monument and accessories I established to perpetuate the original location of this corner:

From the above described brass cap monument:

New BTs:
 A 14 inch diameter Douglas Fir bears S21°E, 37.85 feet marked T5S R30E S11 BT
 A 8 inch diameter Western Larch bears N60°W, 59.38 feet marked T5S R30E S3 BT

Rebuilt the mound of stone around monument, 3 ft. base to top of cap.

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

I hereby certify that the above corner point was perpetuated as hereon described on August 30, 1988.

Witness: Rick Robinson

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Duane I. Griffith
 OREGON
 JULY 10, 1964
**DUANE I. GRIFFITH
 644**

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of... *Survey* County of... *Umatilla*
 State of... *OR* I hereby certify that the within instrument was filed in this office for record on the *27th* day of... *September*, 19...
David H. Trumbull by *Kathleen A. Ambrey*
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor
 Date 9-88
 Rec'd By KA
 No. 88-63-R

☆ U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276

E-17