

MOUNUMENT MARKING DETAIL:



MOUNUMENT AND ACCESSORIES SET:

A Douglas fir, 12" in diam., bears S 71°E., 7.75' dist., marked "T6N R37E ¼ S23 BT"
A Douglas fir, 24" in diam., bears N 64° W., 28.20' dist., marked "T6N R37E ¼ S23 BT"
A Douglas fir, 14" in diam., bears S 0° E., 14.40' dist., marked "T6N R37E ¼ S22 BT"
Set a 5/8" x 30 " iron rebar, 3" above ground, with yellow plastic cap marked "TLS-HDJ" at the base of a Douglas fir, 24" in diam., bears N 58° W., 17.05' dist., marked "T6N R37E ¼ S22 BT"

LOCATION AND COMMENTS:

Corner is on a north facing moderate slope in timbered area. Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 853823.29

E = 8795719.55

COMPASS DECLINATION: 15° East


SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Thomas J. Boshart
Felipe G. Hernandez
Corey A. West
Timothy K. Bannister



Greg E. Flowers

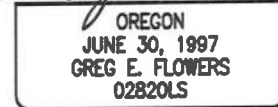

RENEWS 12/31/15

06/29/2015

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 06/16/2014

CORNER DESIGNATION: P-17, Quarter Corner Section for Sections 22 and 23, Township 6 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by A.H. Simmons for Deputy Surveyor George Williams under his contract No. 176 dated October 23, 1872; his notes state "Set post for ¼ Sec. Cor. edge of timber, from which:

A Red fir 20 in. dia., bears N 20° E., 44 lks. dist.

A Red fir 12 in. dia., bears N 33° W., 92 lks. dist.

BLM Cadastral Surveyor C. Alfred White in his April 21, 1965 Survey for Group 572, Oregon, states in his notes: "From the ¼ sec. cor. of secs. 22 and 22, perpetuated by persons unknown, with an iron rod, 1 in. diam., protruding 8 ins. above ground, firmly set, from which bearing trees of which I have no record:

A fallen and decayed fir, 12 ins. diam., bears S. 46° E., 19 lks. dist., mkd. BT on open blaze.

A fir, 15 ins. diam., bears N. 20° W., 9 lks. dist., mkd. BT on opened blaze.

A count of the growth rings on the NW. tree indicates that this corner was perpetuated about 40 years ago. Local land owners state that this corner has been accepted and used for the ¼ sec. cor. for at least that length of time. It is therefore accepted as the best available evidence of the position of the original corner.

At this point

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap marked

¼

S 22 | S 23

T 6N | R 37E

1965

from which new bearing trees

A fir 14 ins. diam., bears S. 32° E., 119 lks. dist., mkd. ¼ S23 BT.

A fir 15 ins. diam., bears S. 63° W., 26 lks. dist., mkd. ¼ S22 BT.

Deposit iron rod alongside the iron post. The corner is located at the intersection of wire fences which bear N., E., and W.

Surveyor Paul W.P. Tomkins noted in his July 14, 2005 survey, shown on Umatilla County Survey record of surveys 05-134-C, "E ¼ Cor. Sec 22. Found 3" BLM brass cap in 2½" pipe protruding 12" stamped "¼ S22/S23 1965"

MONUMENT AND ACCESSORIES FOUND:

Found ¾" BLM brass cap on 2½" pipe marked, ¼ S22, S23, T 6N, R 37E, 1965

The BLM cap is alongside the 1" iron rod as mkd. by BLM. A couple of stray barbed wire remnants are in the area, but no actual fence is present.

A stump bears S 63° W., 17.10 ft. dist., decayed, no sign of old blaze exists.

A stump bears S 32° E., 78.50 ft. dist., decayed, no sign of old blaze exists.

A fir snag bears N 20° W., 5.30 ft. dist., rotted with no sign of blaze, attached BT.