



**LINE TABLE 1**

LINE No.	BEARING	DISTANCE
L1	S09°37'18"E	35.55'
L2	N09°37'18"W	75.04'
L3	S80°22'20"W	23.00'
L4	N09°37'18"W	120.00'
L5	S80°22'20"W	12.00'

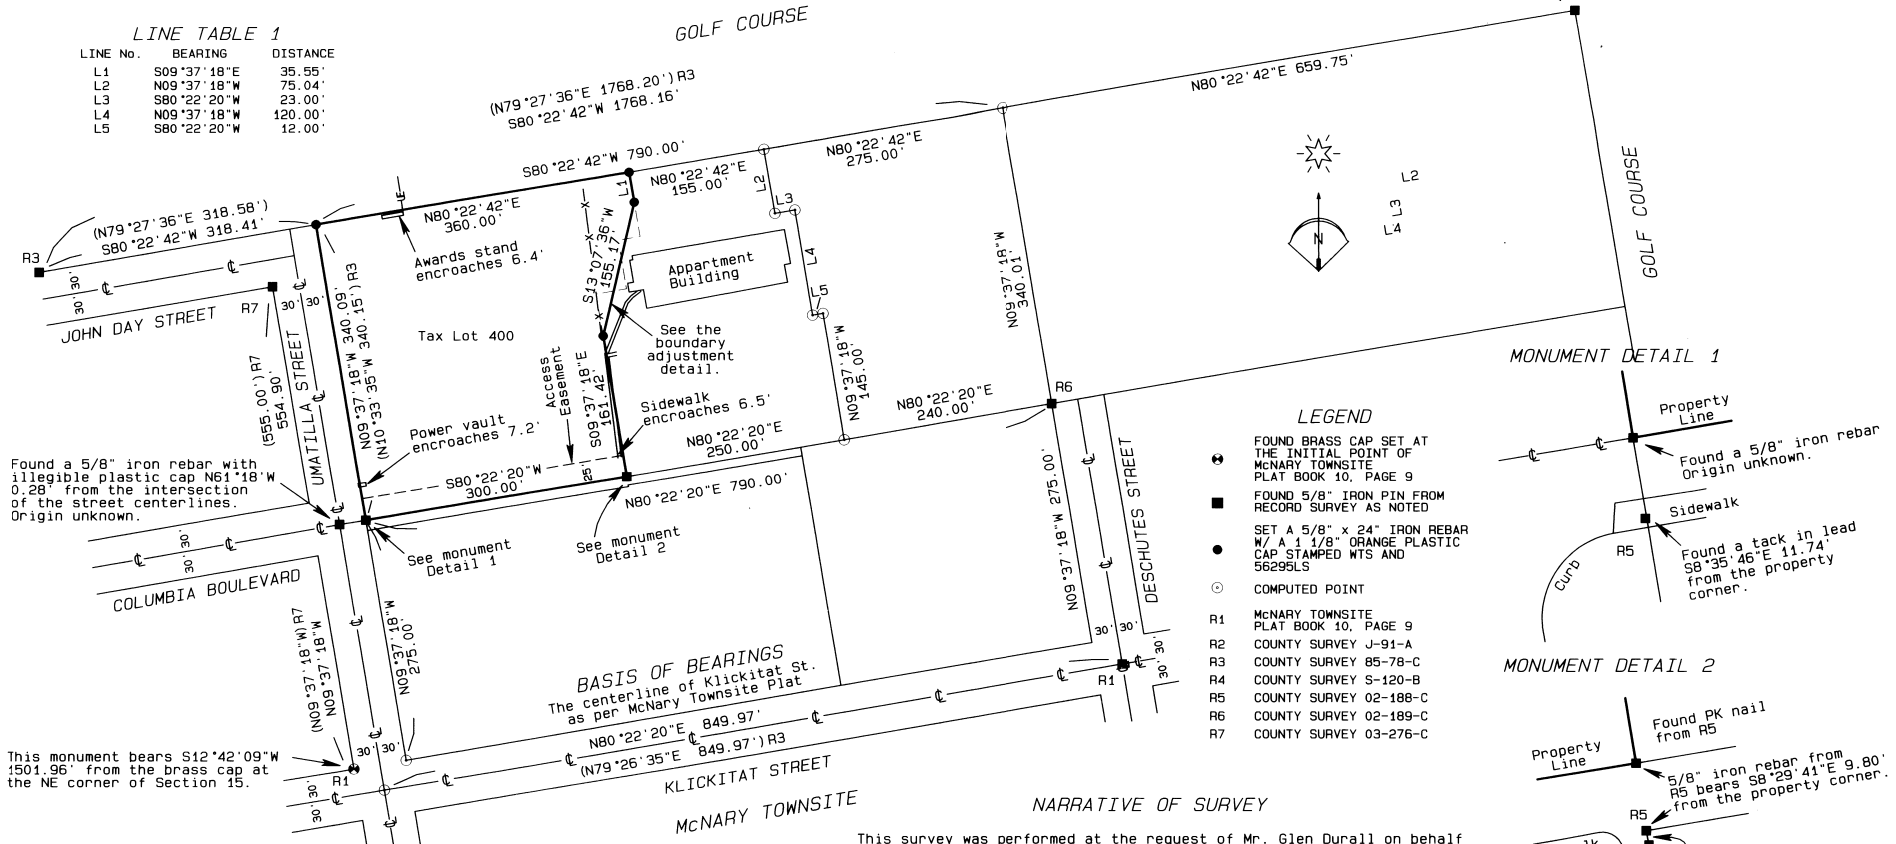

Found a 5/8" iron rebar with illegible plastic cap N61°18'0.28" from the intersection of the street centerlines. Origin unknown.


This monument bears S12°42'09"W 1501.96' from the brass cap at the NE corner of Section 15.

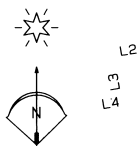


**LEGEND**

- FOUND BRASS CAP SET AT THE INITIAL POINT OF McNARY TOWNSITE PLAT BOOK 10, PAGE 9
- FOUND 5/8" IRON PIN FROM RECORD SURVEY AS NOTED
- SET A 5/8" x 24" IRON REBAR W/ A 1/8" ORANGE PLASTIC CAP STAMPED WTS AND 56295LS
- COMPUTED POINT
- R1 McNARY TOWNSITE PLAT BOOK 10, PAGE 9
- R2 COUNTY SURVEY J-91-A
- R3 COUNTY SURVEY 85-78-C
- R4 COUNTY SURVEY S-120-B
- R5 COUNTY SURVEY 02-188-C
- R6 COUNTY SURVEY 02-189-C
- R7 COUNTY SURVEY 03-276-C

**MONUMENT DETAIL 1**

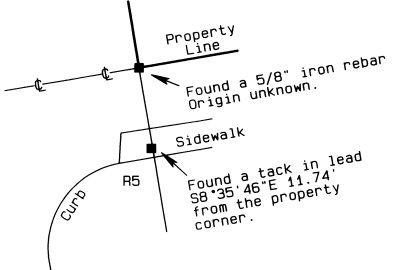

**MONUMENT DETAIL 2**

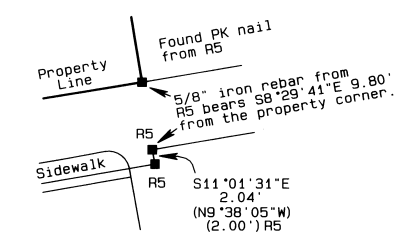

**BASIS OF BEARINGS**  
The centerline of Klickitat St. as per McNary Townsite Plat

**NARRATIVE OF SURVEY**


This survey was performed at the request of Mr. Glen Durall on behalf of Apple Tree Construction, L.L.C.. The purpose of the survey was to identify the boundaries of Tax Lot 400 as shown hereon and also to monument the adjusted boundary line as shown.

The legal descriptions for all of the properties in this area call for bounds that are based on the streets of the plat of the McNary Townsite. That plat was done in 1975 by Mr. David Krumbain. A second survey was also done in 1975 by Mr. Krumbain that is titled "Plat of McNary Complex". There have been several other surveys done in this area but it is my opinion that the legal descriptions should be construed by the monuments set by Mr. Krumbain.

For this reason, I have held the monuments shown along Klickitat Street to control the direction of the east-west lines and the monuments shown along the west line of Umatilla Street to control the north-south lines. This is with the exception of the north line of this property which is called for in the deed as being the southerly boundary of the McNary Golf Course. That boundary was monumented in Survey 85-78-C and I found the monuments as shown in good condition. The record dimensions from that survey are very close to what I find them to be so I have held that line as previously monumented.

Note. The purpose of the boundary adjustment is to increase the setback distance for the existing apartment building as shown in the detail. The location of the adjusted line was determined by the directive to not change the net area of either parcel.

**Boundary Adjustment Detail**

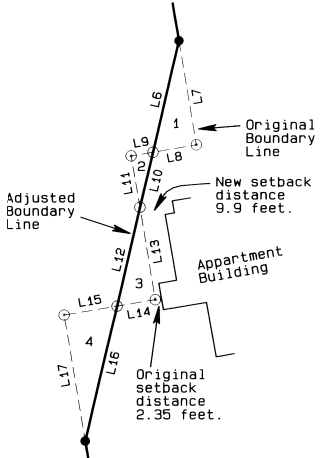

**LINE TABLE 2**

LINE No.	BEARING	DISTANCE
Area 1, 326 sq. ft.		
L6	S13°07'36"W	42.79'
L7	S09°37'18"E	39.46'
L8	S80°22'20"W	16.54'
Area 2, 85 sq. ft.		
L9	S80°22'20"W	9.46'
L10	S13°07'36"W	21.87'
L11	S09°37'18"E	20.16'
Area 3, 255 sq. ft.		
L12	S13°07'36"W	37.78'
L13	S09°37'18"E	34.84'
L14	S80°22'20"W	14.61'
Area 4, 496 sq. ft.		
L15	S80°22'20"W	20.39'
L16	S13°07'36"W	52.74'
L17	S09°37'18"E	48.63'

REGISTERED PROFESSIONAL LAND SURVEYOR  
*Stephen K. Haddock*  
OREGON  
JULY 9, 2001  
STEPHEN K. HADDOCK  
56295LS  
RENEWS 6-30-11

<b>BOUNDARY ADJUSTMENT SURVEY FOR</b>	
APPLE TREE CONSTRUCTION, L.L.C. 8805 Occidental Ave. Suite 3 Yakima, WA 98903	
PROJECT DATE: November 19, 2009	SCALE: 1" = 100'
Project No. 09-15	
<b>WITNESS TREE SURVEYING</b>	
Stephen K. Haddock, PLS P.O. Box 6 Pilot Rock, Oregon 97868 (541) 443-2922	

RECEIVED BY  
Umatilla County Surveyor  
Date: 5-10  
Rec'd By: KK  
No.: 10-75-B