


History of original corner establishment:

Original corner established on September 26, 1882, by Rufus S. Moore under contract number 451, as follows:

Set a basalt stone 14" x 9" x 9", 10" into the ground marked with 4 notches on the south and 4 notches on the east, from which:

- A 26" fir bears N15°E, 11 links (7.26 feet).
- A 18" fir bears N61°W, 5 links (3.30 feet).
- A 20" fir bears S21°W, 5 links (3.30 feet).
- A 40" pine bears S21°E, 18 links (11.88 feet).

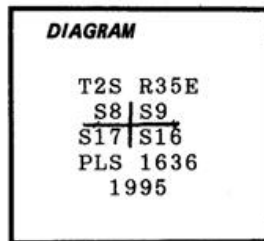

Description of corner evidence found:

The corner stone is gone.

I find the original 26" fir is down, decayed and badly burnt by a recent fire. No marks remain. The bearing tree and land survey monument signs placed on this tree by Larry Kelly in August, 1983, are burnt but still legible. Mr. Kelly found scribes on this tree in 1983. Root crown bears N15°E, 7.3 feet.

The original 40" pine was also recovered in 1983 by Mr. Kelly, who reported visible scribes on this tree at that time. I find this pine is down, decayed and badly burnt. No marks remain. Root hole bears S21°E, 11.9 feet.

A root hole in the ground is all that remains of the original bearing tree to the north west. The original south west bearing tree is gone.


Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point as determined by reference to the original remaining bearing tree evidence, I set a 1" x 30" iron pipe 26" into the ground. A 2 1/4 inch brass cap attached is marked as shown in the diagram above, from which:

- A 13" Ponderosa Pine, scribed "T2S R35E S9 BT", bears N21°E, 75.5 feet.
- A 11" Ponderosa Pine, scribed "T2S R35E S16 BT", bears S20°E, 87.7 feet.
- A 15" Ponderosa Pine, scribed "T2S R35E S17 BT", bears S2°W, 23.3 feet.
- A 12" Ponderosa Pine, scribed "T2S R35E S8 BT", bears N61°W, 21.7 feet.

The four new bearing trees are scribed on double blazes, have a bearing tree sign nailed above the blazes and have a 5/8" brass washer, marked "PLS 1636", nailed flush to the lower blaze.

I hereby certify the above corner point was perpetuated as hereon described on October 28, 1995. Magnetic declination: 20° E.

  
 REGISTERED PROFESSIONAL LAND SURVEYOR  
 DENNIS L. GAYLORD  
 1636

Office of..... County of.....  
 State of..... I hereby certify that the within instrument was filed in this office  
 for record on the..... day of....., 19.....  
 by.....  
 (COUNTY OFFICIAL) (DEPUTY)

J-9

**RECEIVED BY**

Umatilla County Surveyor

Date 11-95  
 Rec'd By KK  
 No. 95-192-R