


FENCE
DETAIL "A"
n.s.

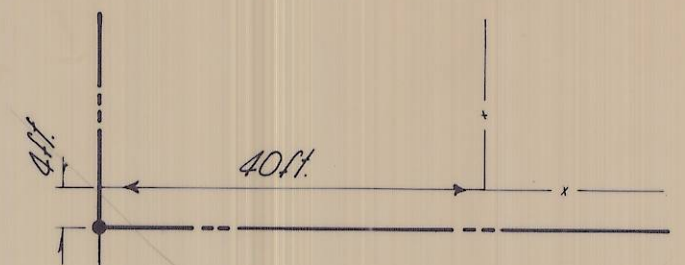


NOTES:

1. Bearings are based on the Survey by James Hanley for the US Forest Service (3/4 to 6E corner of Section 35), dated July 1976, Umatilla County Survey Records drawing no. L-56-B.
2. 1/4 335 / 52 Found Brass cap set by Hanley in 1976, Umatilla County Survey Records drawing no. L-56-B.
3. 35 / 36 Found Brass cap set by Hanley in 1976, Umatilla County Survey Records drawing no. L-56-B.
4. 26 25 / 35 36 Found iron staff with a 5/16" iron pipe along side, used by Storm in 1950, Umatilla County Survey Records drawing no. G-741-C.
5. Found 1/2" iron pin with 1/2" inside diameter iron pipe along side, set by Storm on the section line, found by Walls and Tenneson in 1956, Umatilla County Survey Records drawing no. G-751-B.
6. 1/4 S 26 / 5 35 Found 1/2" inside diameter iron pipe, used by Storms in 1949, Umatilla County Survey Records drawing no. G-751-B.
7. 1/4 334 / 335 Found 1/4" inside diameter iron pipe, being used as the actual 1/4 corner, see survey by Douglas M. Ferguson for Harris Pine Mills, Inc., dated October 1978, Umatilla County Survey Records drawing no. P-118-B.
8. Fence locations are approximate except where shown in fence details.

LEGEND

- denotes Brass Cap set
- denotes 5/16" iron pin set
- denotes monument found as noted
- () denotes record distance
- denotes property boundary
- - - denotes approximate centerlines of roads
- · - denotes existing fence

Section 35, T4N, R37E, W.M.
scale: 1" = 500'

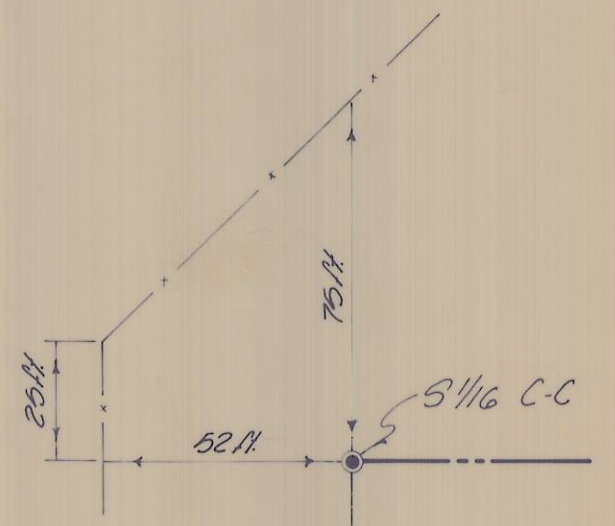

FENCE
DETAIL "B"
n.s.

REGISTERED
PROFESSIONAL
LAND SURVEYOR
Terry E. Hamby
OREGON
JULY 14, 1973
TERRY E. HAMBY
1638

RECEIVED BY
Umatilla County Surveyor
Date 8-19-80
Rec'd by BLS
No. R-149-B

Revised July 23, 1980 MAH

Survey for
MRS. ELLIOT
Section 35, T4N, R37E, W.M.

SCALE 1" = 500'
DATE JULY 15, 1980
DRN BY MAH
CKD BY T.E.H.
DRNG. NO. 80-36C