


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

1997-99, Kaiser, Griffin and Seibold, BLM Cadastral Surveyors, established the corner as follows:
 Point for the E 1/16 sec. cor. of secs. 16 and 21
 Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, in a collar of stone, with brass cap, from which:
 A ponderosa pine, 15 ins. diam. bears S. 50 1/2' E., 20 lks. dist., mkd. E 1/16 S21 BT.
 A ponderosa pine, 17 ins. diam. bears N. 73 3/4' W., 78 lks. dist., mkd. E 1/16 S16 BT.
 Deposit a magnet in a white plastic case at the base of the stainless steel post.

N-12
 360400
 T. 1 N., R. 36 E.
 E 1/16 Corner of sections 16 & 21

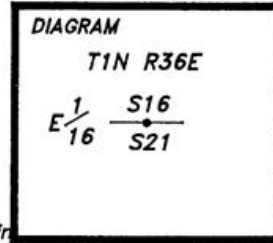

2000, David L. Haddock, Registered Land Surveyor 852, while surveying in sections 21 and 22 for the Umatilla N.F., finds evidence of the original 1/4 corner of sections 16 & 21. This makes the BLM monument an erroneously established corner.

2001, Richard S. Kaiser, BLM Cadastral Surveyor, corrects the BLM's corner as follows:
 Point for the E 1/16 sec. cor. of secs. 16 and 21. From this point, the E 1/16 sec. cor. of secs. 16 and 21, erroneously established by Kaiser, Griffin, and Seibold in 1997-99, bears N. 75°05'07" W., 10.90 ft. dist.; monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above the ground, in a collar of stone, with brass cap mkd. and witnessed as described in the official record.
 Remove the stainless steel post and magnet and at the true corner point
 Reset the stainless steel post, 28 ins. long, 2 1/2 ins. diam., 18 ins. in the ground, to solid rock, and in a mound of stone, 3 ft. base, to top, with brass cap from which a bearing tree mkd. by Kaiser, Griffin, and Seibold
 A ponderosa pine, 15 ins. diam., bears S. 4' W., 5.8 ft. dist., with a partially healed blaze.
 A ponderosa pine, 17 ins. diam., bears N. 74' W., 62.7 ft. dist., with a partially healed blaze.
 Deposit a magnet in a white plastic case at the base of the stainless steel post.

Description of corner evidence found:

Found a 2 1/2" diameter stainless steel pipe, with 3 1/4" diameter brass cap, projecting 8" out of the ground, surrounded by a ring of stones, marked as shown, from which:

15" Ponderosa Pine bears S 4 1/4' W, 5.8 feet, with scribing visible on pitched over blaze facing N 35° W.
 17" Ponderosa Pine bears N 74 1/4' W, 62.7 feet, with scribing visible on pitched over blaze.



Description of monument and accessories established to perpetuate the original location of this corner: _____

DATUM: NAD83(1991) Oregon High Accuracy Reference Network
 STATE PLANE COORDINATES: Oregon North Zone in International Feet
 No. Latitude Longitude Northing(Y) Easting(X)
 360400 45°33'31.03024" N. 118°18'47.23002" W. 697340.652' 8762171.908'

Work Performed By: David A. Schlaich (RLS 2308)
 Witnessed By: Matthew Duffy
 Equipment: Topcon GPT-6005C Total Station
 Magnetic Declination: 17 1/2' East
 Date: July 29, 2002

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

David A. Schlaich

OREGON
 JULY 16, 1987
 DAVID A. SCHLAICH
 2308

RENEWAL DATE: 06/30/2004

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 20.....
 by..... (DEPUTY)
 (COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

SEE MAP OF SURVEY NO. 03-31-B