


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

0-13
400360

T. 1 N., R. 36 E.
N 1/16 Corner of sections 21 & 22

History of original corner establishment:

1997-99, Kaiser, Griffin and Seibold, BLM Cadastral Surveyors, established the corner as follows:
Point for the N 1/16 sec. cor. of secs. 21 and 22
Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, in a collar of stone, with brass cap, from which:
A ponderosa pine, 23 ins. diam. bears N. 72 1/2' E., 18 lks. dist., mkd. N1/16 S22 BT.
A ponderosa pine, 17 ins. diam. bears N. 41 1/4' W., 70 1/2 lks. dist., mkd. N1/16 S21 BT.
Deposit a magnet in a white plastic case at the base of the stainless steel post.

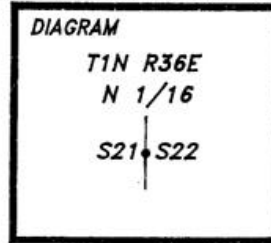

2000, David L. Haddock, Registered Land Surveyor 852, while surveying in sections 21 and 22 for the Umatilla N.F., finds the original corner stone for the 1/4 corner of sections 21 & 22. This makes the BLM monument an erroneously established corner.

2001, Richard S. Kaiser, BLM Cadastral Surveyor, corrects the BLM's corner as follows:
Point for the N 1/16 sec. cor. of secs. 21 and 22. From this point, the N 1/16 sec. cor. of secs. 21 and 22, erroneously established by Kaiser, Griffin, and Seibold in 1997-99, bears N. 39°23'09" W., 45.36 ft. dist.; monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 5 ins. above the ground, in a collar of stone, with brass cap mkd. and witnessed as described in the official record. I obliterate all marks on the NE. bearing tree. Remove the stainless steel post and magnet and at the true corner point Reset the stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap, from which a bearing tree mkd. by Kaiser, Griffin, and Seibold
A ponderosa pine, 17 ins. diam., bears N. 40 1/4' W., 91.8 ft. dist., with a partially healed blaze.
and a new bearing tree
A ponderosa pine, 24 ins. diam., bears S. 16° E., 55.7 ft. dist., mkd. N 1/16 S22 BT.
Deposit a magnet in a white plastic case at the base of the stainless steel post.

Description of corner evidence found:

Found a 2 1/2" diameter stainless steel pipe, with 3 1/4" diameter brass cap, projecting 13" out of the ground, surrounded by a rock mound 2 feet in diameter by 7 inches high, marked as shown, from which:

23" Ponderosa Pine bears S 15 3/4' E, 56.0 feet. with scribing visible on pitched over blaze.
19" Ponderosa Pine bears N 40 1/4' W, 90.8 feet. with scribing visible on pitched over blaze.



Description of monument and accessories | established to perpetuate the original location of this corner:

DATUM: NAD83(1991) Oregon High Accuracy Reference Network
STATE PLANE COORDINATES: Oregon North Zone in International Feet
No. Latitude Longitude Northing(Y) Easting(X)
400360 45°33'17.64150" N. 118°18'28.49554" W. 696021.247' 8763541.148'

Work Performed By: David A. Schlaich (RLS 2308)
Witnessed By: Matthew Duffy
Equipment: Topcon GPT-6005C Total Station
Magnetic Declination: 17 1/2' East
Date: July 29, 2002

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

David A. Schlaich

OREGON
JULY 16, 1987
DAVID A. SCHLAICH
2308

RENEWAL DATE: 06/30/2004

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 20.....
..... by.....
(COUNTY OFFICIAL) (DEPUTY)