


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-191-B.

J-25

**History of original corner establishment:** Record of the original survey by J. Cooper, 1881, states: Set post 4½ ft. long, 4 ins. square, 2 ft. in the ground, on N side of ridge 150 ft. below the summit, 250 ft. above the bottom of ravine, for cor. to Secs. 7, 12, 13, 18, marked:

Index File No. J-1

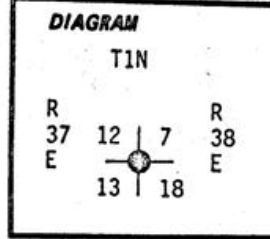

- T1N S7 on NE
- R38E S18 on SE
- R37E S13 on SW
- S12 on NW faces with 4 notches on the S and 2 notches on the N edges, from which:
  - A Fir, 2½ ins. diam. bears N18°E 20 lks. dist., marked T1N R38E S7 BT.
  - A Fir, 6 ins. diam. bears S70°E 18 lks. dist., marked T1N R38E S18 BT.
  - A Fir, 7 ins. diam. bears S53°W 9 lks. dist., marked T1N R37E S13 BT.
  - A Fir, 7 ins. diam. bears N69°W 27 lks. dist. marked T1N R37E S12 BT.

**Description of corner evidence found:**

No trace of the original corner post could be found. We establish the True Corner Point in the following relationship to the original bearing trees as follows:


- An orig. 2½" Fir, now a 6" dead windfall Douglas Fir, with scribing "38E S7 B" visible on a partially healed single blaze bears N73°E 13.2 ft.
- An orig. 6" Fir, now a 10" White Fir, alive and in fair condition, with scribing "138S" visible on a partially-healed upper blaze, lower blaze well-healed, bears S80°E 11.9 ft.
- An orig. 7" Fir, now a 16" White Fir, alive with well-healed double blaze bears S68°W 5.9 ft.,
- And an orig. 7" Fir, now an 18" Grand Fir, alive with well-healed double blaze, bears N50°W 17.8 ft.

**Description of monument and accessories I established to perpetuate the original location of this corner:**

At the True Corner Point, we set a 2"x30" Galvanized Iron Pipe, 28" in the ground on a steep NW slope, with brass cap attached, marked:

From which we mark new BTs:

- A 6" White Fir, scribed "T1N R38E S7 BT" on a double blaze bears N49½°E 53.1 ft.,
- And a 6" Spruce, scribed "T1N R38E S18 BT" on a double blaze bears S19°E 25.7 ft.

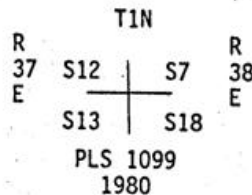

Attached brass washer, marked "LS 1099" to lower blaze of new BTs. Placed steel fence post 5 ft. N of monument with sign 54-4 attached. Attached signs and painted BTs per Standard Specifications for Cadastral Survey, U.S.F.S. Region 6, October, 1979.

I hereby certify the above corner monument was established as herein described on September 30, 1980.

Compass Declination: 20° East

Witness: John Curtiss

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

*Gary L. Langlitz*  
**OREGON**  
JULY 22, 1977  
**GARY L. LANGLITZ**  
1099

Office of.....County Surveyor..... County of.....Umatilla.....  
State of.....Oregon....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)