


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V - 21  
DIAGRAM

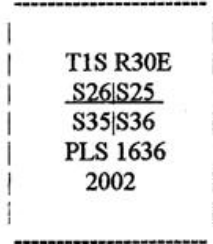

**History of original corner establishment:**

The original corner was established by George S. Pershin, deputy, (compassman) on October 26, 1871, under joint GLO contract No. 154, as follows:

Set a stone (basalt), 18" x 7" x 6", on east hillside for corner to sections 25, 26, 35 and 36.

**Original corner evidence recovered:**

Found the original corner stone solidly set 4" in the ground, but tipped to the east. The corner stone is 18" x 9" x 9", and is plainly marked with five notches on the north edge and one notch on the east edge.

**Monument and accessories established to perpetuate the original position of this corner:**

In place of the original corner stone, I set a 1" x 30" flared, galvanized iron pipe 24" into the ground. A 2 1/2" brass cap attached to the top of the iron pipe is marked as shown in the diagram above. I bury the corner stone along the west side of the pipe and build a mound of stones around the pipe, from which:

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 25", attached at ground level, bears N35° 30' E, 93.3 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 36", attached at ground level, bears S22° 30' E, 95.5 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 35", attached at ground level, bears S24° W, 108.1 feet.

A 5/8" x 36" iron rod set 36" into the ground with a 3/4" brass washer, marked "PLS 1636 26", attached at ground level, bears N38° W, 99.5 feet.

I hereby certify the above corner point was perpetuated as hereon described on March 3, 2002. Magnetic declination set in compass: 16° E.

Renews June 30, 2003

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY  
 Umatilla County Surveyor  
 Date 6-02  
 Rec'd By JK  
 No. 02-145-R