

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


North quarter corner to Section 1, T1S, R32E, W M.

Index: 1S 32 A-23

History of original corner establishment:  
Corner originally set by Thompson in contract 106 dated 1864. His record reads: 40.00 Set post for 1/4 sec. corner in mound of earth with charred stake, pits, trench &c as per instructions.

Evidence Found: None

DIAGRAM

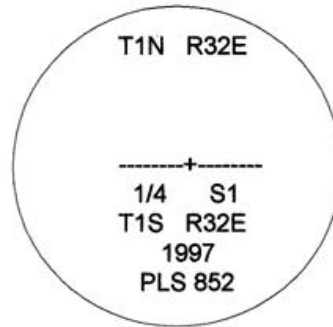

Description of monument and accessories I established to perpetuate the original location of this corner:

At the point proportioned between the corner to Sections 35 and 36, and the south 1/4 corner of Section 36, T1N, R32E,

I set a 1.25" x 12" galvanized iron pipe with a 2.25" brass cap, stamped as shown in the diagram, 3.5 feet north of an east - west fence and flush with the ground.

I set four 5/8" by 24" rebars with 1.25" red plastic caps stamped ORLS 852 and WALS 13922 as described below:

- a rebar bears S88°33'W, 131.81 feet under the west bound fence;
- a rebar bears S86°51'W, 65.14 feet under the west bound fence;
- a rebar bears S85°25'E, 46.38 feet under this east bound fence;
- a rebar bears S87°48'E, 100.88 feet under the east bound fence;

The bearings are true.

This work was done June 9, 1997, and witnessed by Stephen K. Haddock.

Office of \_\_\_\_\_, I hereby certify that the within instrument was filed  
 State of \_\_\_\_\_  
 in this office for record on the \_\_\_\_\_ day of \_\_\_\_\_ by \_\_\_\_\_  
 \_\_\_\_\_ ( COUNTY OFFICIAL ) ( DEPUTY )

REGISTERED PROFESSIONAL LAND SURVEYOR

David L. Haddock

OREGON JULY 12, 1966 DAVID L. HADDOCK 852

RECEIVED BY  
 Umatilla County Surveyor  
 Date 7-97  
 Rec'd By KK  
 No. 97-140-C