

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 9/07/95

CORNER DESIGNATION: E-17. Northeast corner Section 10, T1S., R34E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Corner originally established by James P. Currin and James Noland, under Special Contract dated May 4, 1887.

Surveyor General records state:
Set post, 4 ft. long, 4 ins. sq., 2 ft. in ground, for Cor. to Secs. 2, 3, 10 & 11, marked, T.1 S., S.2 on N.E., S.3 on N.W. R.34 E., S.10 on S.W., S.11 on S.E., 5 notches on S. edge 2 notches on E. edge, from which:
A pine, 18 ins. diam., brs. N.40° E., 91 lks. dist., marked T.1S., S. 2, B.T.
A pine, 14 ins. diam., brs. S.20° E., 85 lks. dist., marked T.1 S., R.34 E., S. 11 B.T.
A pine, 16 ins. diam., brs. S.83° W., 109 lks. dist., marked T.1 S., R.34 E., S.10, B.T.
A pine, 24 ins. diam., brs. N. 54° W., 108 lks. dist., marked T.1S., R.34 E., S.3, B.T.

MONUMENT AND ACCESSORIES FOUND: A 31 in. diameter ponderosa pine with 4 ins. overgrowth over partially healed blaze, no scribing visible and with a healed lower blaze. Bears N 40°E, 61.0 feet, for Section 2 bearing tree. A down 20 in. diameter ponderosa pine with double blaze scribed "BT" on lower blaze, center of stump hole bears S 20° E, 56.1 feet, per record, for Section 11 bearing tree. A thoroughly rotted stump hole, diameter undeterminable, bears S 89° W, 74.5 feet, for Section 10 bearing tree. A rotten 34 in. diameter ponderosa pine stump with burnt lower blaze bears N 46° W, 74.3 for Section 3 bearing tree.

MONUMENT MARKING DETAIL:

T1S R34E
S3 | S2
-----
S10 | S11
1995
ORLS 1639

MONUMENT SET: At average position determined by reverse record bearing and distance intersection from the recovered original Section 2 and 11 bearing trees, set a 2 1/2 in. brass cap on a 1 1/2 in. x 30 in. galvanized iron pipe, projecting 8 in. with a 2 foot diameter mound of stone (marked as shown in the monument detail).

New Accessories:

An 8 in. ponderosa pine with double blaze scribed "T1S R34E S11 BT" bears S 78 1/2° E, 48.8 feet.
An 8 in. ponderosa pine with double blaze scribed "T1S R34E S10 BT" bears S 68° W, 84.1 feet.
A 6 in. ponderosa pine with double blaze scribed "T1S R34E S3 BT" bears N 53 1/2° W, 32.9 feet.
A 1/2 in. brass washer stamped "PLS 1639" was nailed to lower blaze of each new bearing tree. Set a steel fence post near corner monument with witness sign attached.


LOCATION & COMMENTS: Corner falls on flat ground at North edge of small clearing.

COMPASS DECLINATION: 18° East.

Surveyor's Seal

FIRM/AGENCY: William R. Wells, PLS
P.O. Box 1696
Pendleton, Oregon 97801

Witness: William L. Hanley, PLS
Rod Lewis, LSIT

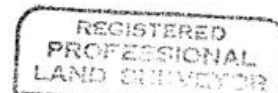

Handwritten signature: William L. Hanley
Stamp: OREGON JULY 14, 1975 WILLIAM L. HANLEY 1639

RECEIVED BY
Umatilla County Surveyor
Date 10-95
Rec'd By KR
No. 95-170-B