


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-25

History of original corner establishment:

Corner was originally established by Jacob C. Cooper, under GLO Contract No. 397, dated July 1, 1881. Surveyor General Records state: Set post 4½ ft. long 4 in. square, 2 ft. in the ground with md. of stone around 3½ ft. at base 18 in. high, on the NE side of head of ravine, 1600 ft. above creek near open timber for Cor. to Secs 7, 12, 13, & 18 marked: T1S, S7 on NE, R37E, S18 on SE, R36E, S13 on SW and S12 on the NW face with 4 notches on the S and 2 notches on the N. edge from which: A pine 28 in. diam. bears S27W 66 lks. dist. marked T1S, R36E S13 BT.

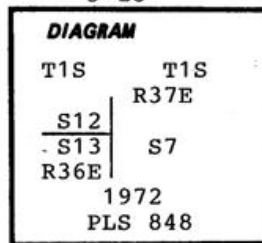

Resurveyed by Douglas M. Ferguson, OPLS 848 in 1972. His record states: Found a mound of stone with remains of original post in ground, from which a pine, 36 in. diam. live in good condition, with scribing visible, bears S 27°W 37 ft. distance.

See page two for continuation of History Record.

Description of corner evidence found:

- Found 2½" galvanized iron pipe with 3" brass cap marked as shown in corner diagram, from which:
- A 16" ponderosa pine bears N 36¼° W - 78.8 feet, with healed blaze.
- A 33" ponderosa pine bears S 29 3/4° W - 37.2 feet, with scribing visible.
- A 18" ponderosa pine bears S 76° E - 48.8 feet, with healed blaze.

Description of monument and accessories | established to perpetuate the original location of this corner:

New accessories established:

- A steel fence post set 3.8 feet West of monument with 54-2 and 54-9 signs attached.
- A 20" ponderosa pine bears S 60½° W - 27.5 feet, scribed: T1S R36E S13 BT. New bearing tree has a brass washer stamped 'PLS 1106' nailed to the face of the blaze. Attached 54-3 and 54-9 signs, painted 6" red band and face of blaze red.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on August 3, 1994.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)



Office of Surveyor County of Umatilla
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 7 day of December, 1994
David H. K... by _____
 (COUNTY OFFICIAL) (DEPUTY)


Form R6-7100-57 (9/71)

RECEIVED BY
 Umatilla County Surveyor
 Date 12-94
 Rec'd By KK
 No. 94-170-B

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-25

History of original corner establishment:
 History of original corner continued.
 Apparently the original surveyor was in error as the record is 43.5 ft dist. Accepted remains of old post as the corner position. Set 30 in. x 2½ in. iron pipe with 3 in. brass cap, (marked as shown in corner diagram) 25 in. in the ground and raised a mound of stone around the pipe for the Cor. to Sections 12 & 13, from which new BT's-- A pine 14 in. diam. bear S78°E 48.3 ft. marked T1S R37E S7 BT. A pine 12 in. diam. bears N34°W 79.5 ft. marked T1S R36E S12 BT. Distances taken to a brass washer in the blaze of each tree. Set a steel fence post approximately 5 ft. East from corner with "Attention" sign attached.
 See Certified Land Record no. H-151-R.

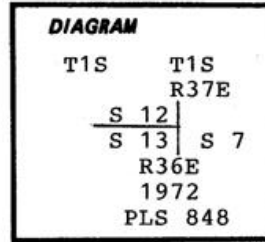

Description of corner evidence found:

Sheet 2 of 2

Description of monument and accessories established to perpetuate the original location of this corner:

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

William R Wells

OREGON
 JULY 22, 1977
 WILLIAM R. WELLS
 1106

renews 12-31-94

Office of Surveyor County of Umatilla
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 7 day of December, 1994
David H. Kline by _____
 (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY

Umatilla County Surveyor

Date 12-94

Rec'd By KK

No. 94-170-B