


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

L - 25

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

This monument was set to replace a prior monument that was destroyed during the construction of a bridge in 1999 over Patawa Creek on Goad Road. The previous monument was set by William Wells LS 1106 in 1992, see C.S. 92-92-C.

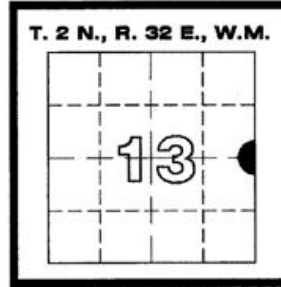

DIAGRAM

DESCRIPTION OF CORNER EVIDENCE FOUND:

A 2 1/2" brass cap on a 30" x 1 1/4" iron pipe.

Four brass washers set as bearing objects

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

Set a 2" aluminum cap upon a 5/8" X 30" iron rod marked:

A. P. A.
 T 2 N
 R 32 E |
 1/4 | R 33 E
 S 13 |
 LS 2872
 1999

Buried 5" below surface of gravel road shoulder.

From which:

A brass washer bears N 61 1/2° E, 92.29', and is nailed with an aluminum nail to PP&L pole.

A 1 1/2" stainless steel washer stamped "AP&A" bears S 82° E, 54.22', and is nailed with a "PK" nail to the southern post of a wire gate.

A brass washer bears N 86 1/2° W, 26.73', and is nailed with an aluminum nail to pole no. 138561.

A brass washer bears N 30° W, 61.03', and is nailed with an aluminum nail to a gatepost.

The brass washers are stamped "W.R. Wells, PLS 1106, and Bearing Object signs are nailed above each washer.

LOCAL DESCRIPTION:

The monument falls +/- 75' south of the bridge, +/- 30 feet south of sign "MILE 2" and 9.0' ENE of the south end of a 2' CMP.

I hereby certify that the above corner point was perpetuated as hereon described on OCTOBER, 22, 1999
Michael B. Posada LS 2849

Witnesses: Rodney Lewis

W:\UMATCO\PATAWA\documents\CERTCORMON.wpd

RECEIVED BY
 Umatilla County Surveyor
 Date 10-01
 Rec'd by JK
 Sta. 01-160-R

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Michael B. Posada
 OREGON
 JAN. 20, 1998
 MICHAEL B. POSADA
 02849LS

EXPIRES 12-31-00

DATED DEC. 9, 1999