

RTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N, R 32E., .M.

Corner Code No. N-7


Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by Daniel Chaolin, U. S. Deputy Surveyor, under Contract No. 107, dated September 21, 1864. The original notes state:

Set post for 1/4 Sec. corner in mound of earth with charred stake and etc. as per instructions.

In 1980, during Survey No. R-28-B, the corner position was calculated based on single proportion measure between the Northwest and Northeast corners of Section 20.

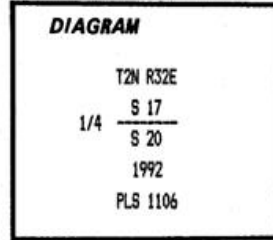

Corner No. _____
Compass Declination: 18.0°

Description of corner evidence found:

None. This corner falls in an active wheat field. Re-established corner position by single proportion measurement between the re-established Northwest corner of Section 20 and the monumented Northeast corner of Section 20.

Note: The boundary of the old Umatilla Indian Reservation intersects the North line of Section 20, and a closing corner was established in 1887. Due to farming operations in the area, all evidence of the Old Reservation Boundary has been destroyed in this area. The 1/4 corner was therefore re-established by single proportion measurement, using the Chaplin record.

Description of monument and accessories established to perpetuate the original location of this corner:

At the re-established corner point, set a 2 1/2" brass cap on a 1 1/4" by 30" galvanized iron pipe with the top of the cap buried 18" below the ground surface.

Referenced the corner monument as follows:

A brass washer stamped "PLS 1106" nailed to the South side of PP&L power pole No. 204900, 1' above ground, bears N 76° 51' W 65.3'. Placed bearing object sign on the pole. Also placed witness corner sign on this pole.

A brass washer stamped "PLS 1106" nailed to the North side of PP&L power pole No. 205900, 1' above ground, bears N 85° 58' E 220.8'. Placed bearing object sign on the pole.

The N.E. corner of the metal pump base plate on an existing irrigation well bears N 68° 20' W 84.1'.

The center of the pump motor on the existing irrigation well bears N 69° 45' W 84.7'.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY

Umatilla County Surveyor

Date 8-92

Rec'd By KR

No. 92-92-C