

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N , R 32E. , W.M.

Corner Code No. R-7

Note: Monument marked as shown below

History of original corner establishment:


This corner was originally established by Daniel Chaplin, under Contract No. 107, dated September 21, 1854. The original notes state:

Set post for 1/4 sec. corner in mound of earth with charred stake, pits & c., as per instructions.

Jas. P. Currin and Jas. Noland, under Special Contract dated May 4, 1887, state in their original notes:

Set a post 4 feet long and 4 ins. square, 24 ins. in the ground for 1/4 Sec. Corner marked 1/4 S. on North face and raised a mound of stone over it. Pits impracticable.

This corner was re-established by single proportion measurement as shown on Map No. R-28-B.

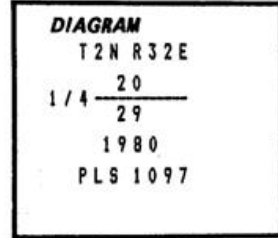

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Found a 2 1/2" brass cap on 2 1/2" galv. iron pipe, protruding 8" from mound of stone. (From Map No. R-28-B).

Description of monument and accessories established to perpetuate the original location of this corner:

Set a steel fence post 4.2 feet East of the corner, with a Witness Post sign attached.

New bearing objects:

- A 5/8" x 30" iron pin bears N 53 1/2° W - 19.5 feet. (Flush with ground).
- A 5/8" x 30" iron pin bears N 43° E - 31.0 feet. (Protruding 4" from ground).
- A 5/8" x 30" iron pin bears S 56° E - 9.2 feet. (Protruding 3" from ground).
- A 5/8" x 30" iron pin bears S 83° W - 44.2 feet. (Protruding 2" from ground).

All pins are capped with a 1 1/2" yellow plastic cap, marked "WR WELLS, PLS 1106". Bearing Object signs are wired to each pin.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12/31/94

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)