

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 2N , R 33E. , W.M.

Corner Code No. C-21

Note: Monument marked as shown below

History of original corner establishment:

This corner was most recently established by C.E. Redfield, U.S. Indian Service Surveyor. Redfield's notes indicate he established the corner but the notes do not state the type of corner monument set. Redfield's notes were found in the BIA Realty Section vault at the Umatilla Agency.

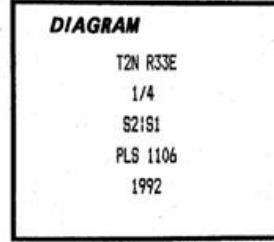

C-21

Corner No. Compass Declination: 18.0°

Description of corner evidence found:

Found a 1 1/4" iron rod at projection of North and East fences. The 1 1/4" iron rod was buried about 2'. See Survey No. 92-29-C.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2 1/2" brass cap on 1 1/4" by 30" iron pipe over the 1 1/4" iron rod and surrounded with a mound of earth and stone from which:

- A brass washer in the SE corner of a shed bears N 26 1/2°W - 65.10'. Washer is marked "PLS 1106". Attached Bearing Object sign to shed.
A 5/8" by 30" rebar bears N 03 1/2°W - 25.00' with a yellow plastic cap marked "W.R. Wells, PLS 1106" attached.
A 5/8" by 30" rebar bears S 88°E - 20.00' with a yellow plastic cap marked "W.R. Wells, PLS 1106" attached.
A 5/8" by 30" rebar bears S 23 1/2°E - 24.00' with a yellow plastic cap marked "W.R. Wells, PLS 1106" attached.

Set a 5.5 foot steel fence post approximately 1 foot from each reference corner rebar with a Bearing Object information sign attached.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
(COUNTY OFFICIAL) by (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY Umatilla County Surveyor \*GPO-788.276

Date
Rec'd By KTK
No. 92-29-C