


History of original corner establishment:

The original corner was established by Daniel Chaplin on November 20, 1864, under GLO contract no. 107, as follows:

Set stone, 24" x 6" x 6", for 1/4 section corner.

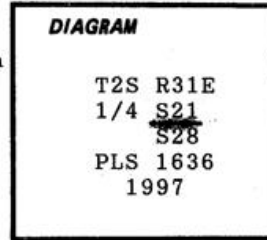

Description of corner evidence found:

Found the original corner stone loosely set in a mound of stones in an east-west fence line. The stone, which is 17" x 6" x 5", is plainly marked "1/4".



Description of monument and accessories established to perpetuate the original location of this corner:

In place of the original corner stone, I set a 1 1/2" x 30" iron pipe 22" into the ground. A 2 1/2" brass cap attached is marked as shown in the diagram above. I bury the original corner stone along the north side of the pipe and build a mound of stones around the pipe, from which:

- A 5/8" x 24" iron rod, set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S21 NE", attached at ground level, bears N36°E, 90.8 feet.
- A 5/8" x 27" iron rod, set 21" into the ground and surrounded by a small mound of stones and with a 3/4" brass washer, marked "PLS 1636 S28 SE", attached at ground level, bears S22°30'E, 81.0 feet.
- A 5/8" x 24" iron rod, set 20" into the ground and surrounded by a small mound of stones and with a 3/4" brass washer, marked "PLS 1636 S28 SW", attached at ground level, bears S58°W, 79.8 feet.
- A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 S21 NW", attached at ground level, bears N28°W, 128.4 feet.

I hereby certify the above corner point was perpetuated as hereon described on October 13, 1997. Magnetic declination: 20°E.

Office of County Surveyor County of Umatilla
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 13 day of October, 1997
 _____ by _____
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
 Umatilla County Surveyor
 Date 10-97
 Rec'd By AK
 No. 97-193-R