


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R - 5
DIAGRAM

History of original corner establishment:

The original corner was established by Daniel Chaplin on November 21, 1864, under GLO contract No. 107, as follows:

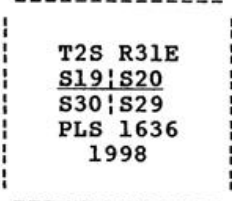

Set stone 22" x 8" x 8" for corner to sections 19, 20, 29 and 30.

Corner evidence recovered:

Found the original corner stone loosely set on the north edge of a mound of stones. The corner stone is 22" x 8" x 7" and is plainly marked with five notches on the north edge and five notches on the east edge.

Monument and accessories established to perpetuate the original location of this corner:

In place of the original corner stone, I set a 1" x 30" iron pipe 18" into the ground to bedrock. A 2 1/2" brass cap attached is marked as shown in the diagram above. I bury the corner stone along the east side of the pipe and build a mound of stones around the pipe to the cap, from which:

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S20", attached at ground level, bears N61°15'E, 144.7 feet.

A 5/8" x 24" iron rod set 20" into the ground with a 3/4" brass washer, marked "PLS 1636 S29", attached at ground level, bears S48°30'E, 147.9 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S30", attached at ground level, bears S60°W, 138.8 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S19", attached at ground level, bears N59°W, 133.8 feet.

I hereby certify the above corner point was perpetuated as hereon described on May 10, 1998. Magnetic declination: 18° E.



Renews June 30, 1999

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on _____, 1998.

RECEIVED BY
Umatilla County Surveyor
Date 6-98
Rec'd By JK
No. 98-111-R