

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner not previously established.

T 2 S R 35 E A-10

■		
S	4	

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

None.

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:**

At position determined by survey, I set a 5/8"x30" iron pin, 26" in the ground, with 2 1/2" aluminum cap marked as shown below, in a collar of stone 2 ft. diam., from which:

**NEW BEARING TREES:**


A 23" Douglas Fir bears North 86° West, a distance of 38.75 feet, marked W 1/16 S4 BT.

A 7" Ponderosa Pine bears North 87° East, a distance of 25.70 feet, marked W 1/16 S4 BT.

Corner falls approx 5 ft. East of a cliff edge.

I hereby certify that the corner was monumented on September 27, 2018.

Witness: Kyle Tucker

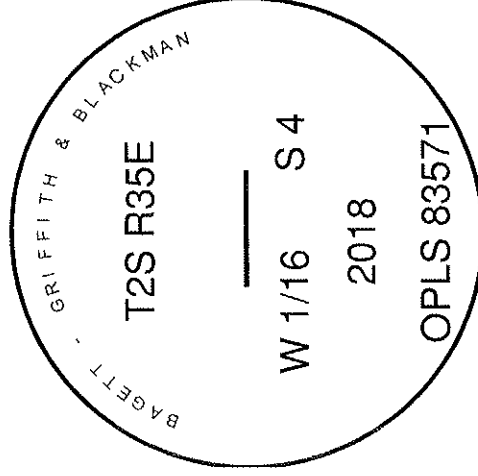

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
June 2, 2010  
JEFFREY S. HSU  
83571

Renewal Date: June 30, 2019

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

A-10

18-105-8