

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 3N, R 29E., W.M.

Corner Code No. V-21


Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by N.H. Gates, Deputy Surveyor, under his Contract No. 84, dated July 22, 1859.

The original notes state:

*Set post for corner to Secs 25, 26, 35 & 36 in mound of Earth & as per instructions.

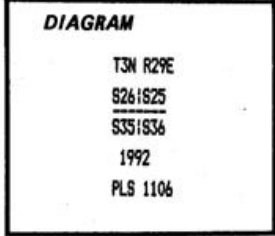

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Four way intersection of old fences extending North, South, East and West. After confirming location by survey, I accept the fence corner as the best remaining evidence of the original corner location, and remonument the corner as indicated below.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2 1/2" Brass cap on a 1 1/4" by 30" G.I.P. 24" in ground and surrounded with a mound of earth and stone, from which:

- A 5/8" by 30" rebar bears N 31° W - 34.17 feet.
- A 5/8" by 30" rebar bears N 54 1/2° E - 33.77 feet.
- A 5/8" by 30" rebar bears S 19 1/2° E - 18.12 feet.
- A 5/8" by 30" rebar bears S 77° W - 29.94 feet.

All rebar capped with a yellow plastic cap marked "W.R. Wells, PLS 1106". A steel fence post was set approx. 1' from rebars with Bearing Object signs attached.

Set a steel fence post South of monument and attached a Witness Corner sign. Corner at intersection of North-South, East-West fences.

| |
|---|
| REGISTERED PROFESSIONAL LAND SURVEYOR |
| <i>William R. Wells</i> |
| OREGON JULY 22, 1977 WILLIAM R. WELLS 1106 |

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY

Umatilla County Surveyor
Date 6-92
Rec'd By JK
No. 92-65-C