

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 09/23/13

CORNER DESIGNATION: 3N32, C05, The East One-Quarter Corner of Section 6.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under Contract 107, dated September 1864, notes state: Set post for 1/4 Sec. cor. in mound of Earth with charred stake pits & c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N R32E
1/4
S6 | S5
2013
PLS 54657

MONUMENT SET: There are no possessory features to use at this corner point. Reestablished corner position by single proportion measurement between the Southeast and Northeast corners of Section 6 using the Chaplin record. At a calculated point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with top 3" below ground level, in barn yard area 20'+/- North of gravel drive, marked as shown in "Monument Marking Detail", from which:

A 3/4" brass washer stamped "PLS 1106" in 6" diameter wood fence post bears North 39 1/2° East, 40.0 feet.

A 5/8" x 20" iron pipe with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", East of a concrete retaining wall, bears South 22° East, 36.3 feet.

A 5/8" x 20" iron pipe with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", at West end of concrete retaining wall bears South 27° West, 63.8 feet.

A 3/4" brass washer stamped "PLS 1106" in 6" diameter wood fence post bears North 53° West, 46.5 feet.

Wired bearing object tags to accessories by retaining wall only.

LOCATION AND COMMENTS: At a calculated point in a barn yard area 20' +/- North of a gravel drive.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:


N= 770659.92'
E= 8623387.45'

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS
Dean Roy
\\3N32C05

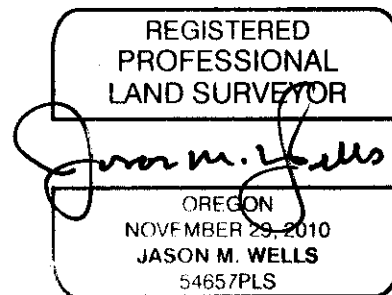

RENEWS: 6-30-14