

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 3N, R 37E., W.M.


Corner Code No. E-21

Note: Monument marked as shown below

History of original corner establishment:

Corner was established by George S. Pershin under Contract No. 340 dated September 26, 1879. Original notes state: Set a basalt stone 16 ins. x 14 ins. x 4" on steep NE face of bluff for cor to secs 1-2-11 & 12 from which: A fir 10 ins. diam bears N 15° E 70 lks. dist. marked T3N R37E S1 BT. A fir 12 ins. diam. bears S 46° E 24 lks. dist. marked T3N R37E S12 BT. A fir 11 ins. diam. bears S 38° W 15 lks. dist. marked T3N R37E S11 BT. A fir 16 ins. diam. bears N 40° W 34 lks. dist. marked T3N R37E S 2 BT.

In 1976, J.D. Hanley, as reported on Certificate No. G-11, recovered and re-monumented the corner. Certificate Record states: A basalt stone 16" x 14" x 4" in place on NE face of steep hillside (65% slope) A 22" fir bears N 15° E 46.2 ft. (70 lks) dist. with previously opened blaze with visible scribing 31" inside 4" of overgrowth. A 34" fir bears S 46° E 15.8 ft (24 lks) dist. with healed blaze. A 28" fir bears S 45° W 9.9 ft. (15 lks) dist. with healed blaze. A 30" fir bears N 40° W 22.4 ft. (34 lks) dist. with healed blaze. Set a 2 1/2 brass cap on a 2" iron pipe 31" long 6" above the ground in earth and rock mound with a 6" steel fence post 3' west with signs 54-4 and 54-2 attached. Painted B1 blazes with red paint and attached sign 54-3 to each BT. Buried stone alongside brass cap monument.

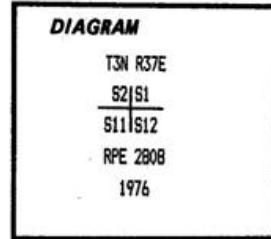

E-21

Compass Declination: 18.0°

Description of corner evidence found:

Found 2 1/2" brass cap on 2 1/2" galvanized iron pipe projecting 2" out of a mound of stone from which:

- A 22" white fir bears N 15°E, 44.8' with a previously opened blaze. (Original bearing tree)
A 34" white fir bears S 46°E, 15.8' with a healed blaze. (Original bearing tree)
A 28" dying white fir bears S 45°W, 9.9' with a healed blaze. (Original bearing tree)
A 30" white fir bears N 32°W, 22.4' with a healed blaze. (Original bearing tree)

Description of monument and accessories established to perpetuate the original location of this corner:

Maintained monument by cleaning up around it.

There is a steel fence post 3' West with 54-2 and 54-9 signs attached.

Marked 2 new bearing trees:

- A 11" white fir bears N 27°E, 51.9' scribed T3N R37E S1 BT.
A 10" white fir bears S 01 1/2°W, 30.7' scribed T3N R37E S11 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached signs 54-3 and 54-4 or 54-9 and painted face of blaze and a 6" red band around each bearing tree.

Corner located on steep East slope 250' West of Coyote creek.

Note: There is a blazed 10" white fir N 35°E, 30.6' from corner with no scribes. (a yellow jacket nest was encountered at base of this tree)

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY Umatilla County Surveyor Date 1-92 Rec'd By KK No. 92-02-R