


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by George S. Pershin under GLO contract number 430, dated March 23, 1882. Surveyor General record states:
 Set a post 4 ft long 4 in dia 2 ft in ground on NE slope for ¼ sec cor marked ¼S on W side
 A Fir 12 ins di. brs. S85°E 22 lks dist marked ¼S BT
 A Fir 10 ins di. brs. S85°W 12 lks dist marked ¼S BT

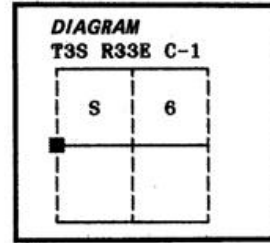


Corner remonumented in 1977 by BLM surveyor Craig L. Wanless, Group number 350. His record states: The ¼ sec cor of secs 1 and 6 on the E bdy of the Tp., determined at record bearing and distance from the remains of the original bearing trees:
 A decayed fir stump, size indeterminate, bears S85°E, 22 lks dist, with scribe marks ¼S visible on overgrowth lying alongside. A decayed fir stump, size indeterminate, bears S85°W, 12 lks dist, with fragmentary scribe marks visible on overgrowth lying alongside. At the corner point, Set an iron post, 28 ins long, 2½ ins diam, 24 ins in the ground, with brass cap marked: (shown below) from which new bearing trees; A fir 20 ins diam bears S77°E, 54 lks dist mkd ¼ S6 BT. A fir 15 ins diam, bears S83°W, 21 lks dist, mkd ¼ S1 BT
 Corner is located 5 lks West of wire fence, extending N and S.
 No record of subsequent monumentation found in Umatilla County survey records.
 Description of corner evidence found:

Found 2½ inch diameter BLM brass cap monument marked as shown: The original bearing trees are rotted beyond recognition.

Found a 22 inch diameter White Fir S77°E, 54 lks, live but sickly with scribes visible.

Found a 15 inch diameter White Fir S83°W, 21 lks, nearly dead with scribes visible.

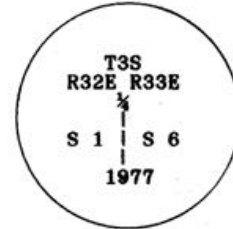

Distances to the BTs are to the center of the tree.

Description of monument and accessories I established to perpetuate the original location of this corner:

There are no trees in the area healthy enough for new bearing trees. I therefore set steel fenceposts for bearing objects as follows:

New Bearing Objects:

A 6 ft. steel fencepost driven 28 inches in the ground bears North, 5.35 feet, with bearing tree, land survey monument, and property boundary signs attached.
 A 6 ft. steel fencepost driven 32 inches in the ground bears S83°E, 5.52 feet, with bearing tree, and land survey monument signs attached.

Painted a 6 inch red band around all BTs.

I hereby certify that the above corner point was perpetuated as hereon described on September 1, 1988.

Witnesses: Jeff Petersen and Rick Robinson



I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to the face of the steel fencepost.

Office of: Survey County of: Umatilla
 State of: OR, I hereby certify that the within instrument was filed in this office for record on the 22nd day of September, 1988
David H. Kumbren by Kathleen K. Amberg
 (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY

Form R6-7100-57 (9/71)

Umatilla County Group 701

☆ U.S. GOVERNMENT PRINTING OFFICE - 1983-793-276

Date 9-88
 Rec'd By KA
 No. 88-92-C