

OREGON CORNER RESTORATION FORM

SECTION 22 TOWNSHIP 4 NORTH RANGE 29 EAST N-15

COUNTY : UMATILLA DATE 8-98

CORNER DESIGNATION

NORTH 1/4

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNCOVERED
 SURVEYED IN
 REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.


ORIGINALLY SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101. HE SET A POST IN A MOUND OF EARTH AND A CHARRED STAKE.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

NOTHING

SKETCH

MONUMENT DETAIL

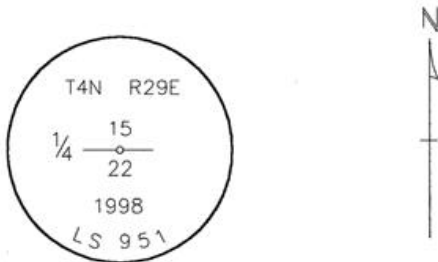

MONUMENT SET (PROCEDURES AND DESCRIPTION)

BY SINGLE PROPORTION, I SET 1" X 30" IRON PIPE WITH A 2 3/8" BRASS CAP STAMPED AS ABOVE, 3" ABOVE THE SURFACE.

NEW ACCESSORIES FROM WHICH

- A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES N 00°.17'10" E, 21.68 FEET.
- A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES N 87°.59'27" E, 331.32 FEET.
- A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES S 00°.17'10" W, 20.67 FEET.
- A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES S 89°.24'14" W, 36.52 FEET.

LOCATION AND COMMENTS

COMPASS DEC.

SURVEYOR'S SEAL

RECEIVED BY

Umatilla County Surveyor

Date 10-98

Rec'd By KK

No. 98-213-C

FIRM/AGENCY

EDWARDS SURVEYING
P.O. BOX 763
HERMISTON, OREGON 97838
97838

PARTY CHIEF

D. EDWARDS

NOTES

WITNESS

RICK SMITH

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951

RENEWS 12/31/99