

ERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 4N, R 36E., W.M.

Corner Code No. T-25


Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by William Odell, U.S. Deputy Surveyor, under Contract No. 114 dated July 2, 1866. The original notes state:

Set post corner for 1/4 Sec. on side hill in thick underbrush, from which:

A larch, 4 ins. diam. brs S 20° E., 12 lks.  
A larch, 5 ins. diam. brs N 15° W., 15 lks.

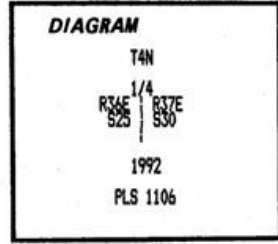

Corner No. 18.0°  
Compass Declination: 18.0°

Description of corner evidence found:

No evidence of this corner was recovered after a diligent search of a 150' radius around the calculated corner position. The area has been logged years ago and has been burnt.

This corner was re-established by single proportion measure between the Southeast and Northeast corners of Section 25.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2 1/2" brass cap on a 2 1/2" by 30" galv. iron pipe 24" in ground and surrounded with a mound of earth and stone. Cap marked as shown in corner diagram.

New bearing trees:

- A 15" white fir bears N 90° E - 15.1', scribed 1/4S30BT.
- A 7" white fir bears N 22° E - 16.9', scribed 1/4S30BT.
- A 6" white fir bears N 74° 1/2 W - 24.9', scribed 1/4S25BT.
- A 5" Douglas fir bears S 51° W - 17.9', scribed 1/4S25BT.

Attached bearing tree signs on bearing trees.

Set a steel fence post South of corner with a Witness Corner sign attached.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

Office of..... County of.....

State of..... I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by ..... (DEPUTY)

(COUNTY OFFICIAL)

RECEIVED BY

Umatilla County Surveyor

Date 7-92

Rec'd By AK

No. 93-79-B

☆ GPO-798-276