

Index
File No. G-5

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or Survey No. _____ Cor. No. _____


T 4 N 38 E

R.D. Walla Walla County Umatilla

Merid. Willamette

N.F. Umatilla State Oregon

CORNER DIAGRAM

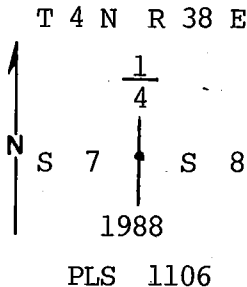

DESCRIBE CORNER MONUMENT FOUND

Found an upright 18x12x6" basalt stone with fractured west face on a mound of stone from which:

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

A 12" douglas fir brs S86°W, 87.1' with scribes visible on opened blaze. (OBT)
A 12" douglas fir brs S22°E, 37.6' with scribes visible on opened blaze. (OBT)

NOTE: Mound of rocks and corner stone were painted with yellow paint.

PHOTO IDENTIFICATION DATA

Photo No. 880-50
Filed At. Umatilla, S.O.
Object Ident. corner
Ident. By W. R. Wells
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Corner located 50' West of ridgetop on a slope facing West.

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature

W. R. Wells

Title

Land Surveyor

Division

Headquarters

Pendleton, Or.

Date

8-12-88

FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

At position of found stone...
Set 2½" aluminum cap on 2½" x 30" aluminum pipe 22" in ground to bedrock & surrounded with mound of earth & stone. Set 6' fence post North of corner with sign 54-4 attached. Cap marked as shown in corner diagram. Buried corner stone in new mound.
Compass declination 19° East.

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

New bearing trees established:
A 13" ponderosa pine brs S6°W, 2.0' scribed 1/4S7 BT.
A 6" douglas fir brs N82°E, 32.9' scribed 1/4S8 BT.
New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-4 to each BT and painted face of blaze & 6" red band around each BT.

Work Done By W.R.Wells Title Land Surveyor Date 8-12-88 State Registration No. ORLS 1106
or Agency

Certified Cor. Record Prepared ? Yes XXXX Filed At: County Surveyor

Date

REMARKS

Index File No. G-5 T. 4 N R. 38 E W.M. Tract or Surv. No.

Cor.

Index File No. G - 5

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or Survey No. _____

Cor. No. $\frac{1}{2}$ Cor 4

T 4N R. 38E


R.D. Walla Walla County Umatilla

Merid. Willamette

N.F. Umatilla State Oregon

CORNER DIAGRAM

DESCRIBE CORNER MONUMENT FOUND

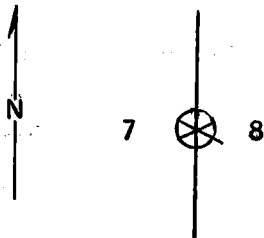

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

10" Fir
"1/2 S 7 BT" legible

(BT Bears W Dist 22" DBH
(LIVE)
BT Bears E Dist 15" DBH

11/76 CK BCC

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____

Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature
John Blom
John Blom

Title
Engr Tech

Division
Engr

Headquarters
Walla Walla

Date
4/5/71

7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT : DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

9

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

10

Work Done By _____ Title _____ Date _____ State Registration No. _____
or Agency _____

Certified Cor. Record Prepared ? Yes No Filed At: _____ Date _____

11

REMARKS

12

Index File No. G-5 T. R. M. Tract or Surv. No. Cor. 13