


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-3

History of original corner establishment: Corner established by Robert F. Omeg, U.S. Deputy Surveyor, under his Contract No. 761, dated June 16, 1905. Surveyor General records state: Set a basalt stone 15x10x5 ins. 10 ins. in the ground for 1/4 sec. cor. marked 1/4 on N face; from which, A fir 15 ins. in diam. bears N5°W, 73 lks dist marked 1/4S7 BT. And raised a mound of stone 2 ft base and 1 ft and a half high N of cor. No other bearing trees available.

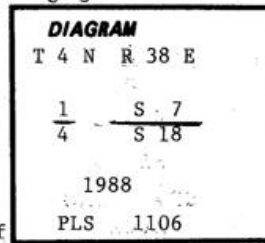


A.J. Lommasson remonumented the N & S quarter-section corners of Sec. 7 in 1971... No certified record of land corner monumentation was found in County records. However, the Umatilla National Forest has a land corner card on file for each corner prepared by J.W. Blom in April 1972, and Blom's recovery record states: Basalt stone mkd 1/4 on N face just S of mound of stone. A dead down 20" fir brs N7°W, 60 ft dist scribed 1/4S7 BT. (Set) 2" pipe, 36" long flared on bottom with 3" bronze disk brazed to top 20" into ground. Disk stamped as shown. New bearing trees: A 14" red fir brs N45°E, 32 ft dist marked 1/4S7 BT. A 44" red fir brs S43°W, 150 ft dist and 75 lower than corner marked

Description of corner evidence found:

1/4S18 BT. Both BTs are tagged with BT posters. The 14" fir also has location poster and USFS warning poster.

In a mound of stone, found a 18x9x6" basalt stone marked "1/4" on N face. The monument from the 1971 Lommasson survey was found about 50' downhill from the corner stone. Re-established corner position in the hole in mound of stone where the Lommasson monument fell from. From the re-established cor. position... A 15" uprooted douglas fir brs N5°W, 48.2' with scribes visible (OBT). A 18" douglas fir brs N45°E, 32.0' with scribes visible on partially healed blaze (L.BT). A 44" douglas fir brs S43°W, 150.0' with scribes visible (L.BT). Lommasson monument is a 2 1/2" x 36" iron pipe with 3" brass cap marked as shown to right...

Lommasson's monument is marked:

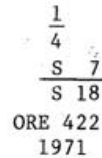

Description of monument and accessories established to perpetuate the original location of this corner:

At the reestablished corner position...

Set 2 1/2" aluminum cap on 2 1/2" x 30" aluminum pipe 18" in ground to bedrock & surrounded with mound of earth & stone. Set 6' fence post West of corner with sign 54-4 attached. Cap marked as shown in corner diagram. Placed Lommasson's monument & corner stone in mound.

Painted blazes and a 6" red band around each BT, attached signs 54-3 and 54-4 to each BT.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented by me on August 31, 1988.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of... County Surveyor County of... Umatilla
State of... Oregon I hereby certify that the within instrument was filed in this office
for record on the... 17... day of... October... 19... 88
David H. Krumboltz by *William R. Wells*
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor
Date 10-88
Rec'd By [Signature]
No. 88-64-B

*GPO-591-971, 1988