


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Index S-7

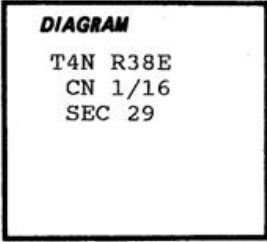

A: Corner not established by GLO:
Corner established by survey 1989 ORS 2060
Recorded Umatilla County Surveyor's Office

Description of corner evidence found:

B: Monument found: 2.5 inch diameter aluminum monument marked per record, with top 9 inches bent horizontal to ground due to windfall impacting monument. Monument firmly in-place in vertical condition below ground.

Accessories found:

10 inch dbh spruce bears S46W at 52.3 feet per record
25 inch dbh spruce bears N80E at 25.4 feet WINDTHROWN

Description of monument and accessories established to perpetuate the original location of this corner:

C: After carefully digging out the original monument I set in same position a 2.5 inch diameter by 30 inch long aluminum monument 25 inches in the ground. No stones available. I mark the cap:

T4N R38E WM
 N $\frac{1}{16}$
 C 16
 S29 $\frac{1}{16}$
 C
 1991

STRYKER PLS 2060


New Accessories established
13 inch diameter true fir
bears N51W at 80.6 feet
blazed and scribed
"CN 1/16 S29 BT"

Placed a steel fence post 3.2 ft.
west of monument with 54-9 sign
attached.

I painted a 6" red band
around the bearing tree,
painted the blaze red, and
placed brass washer "PLS
2060" at base of blaze.
Placed 54-3 (BT) and 54-9
(LSM) signs on new BT.

Witness: Tom Woody

REGISTERED
PROFESSIONAL
LAND SURVEYOR

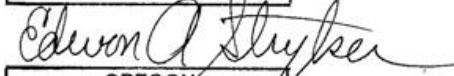

OREGON
JULY 15, 1983
EDWIN A. STRYKER
2060

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by.....
 (COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

RECEIVED BY
 Umatilla County Surveyor
 Date 5-96
 Rec'd By KK
 No. 96-79-R

Ref. #89-107-B
 *GPO-591-971, 1988