

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner established in 1882 by George S. Pershin under General Land Office Contract No. 430.

Surveyor General's notes state:

Set basalt stone 18x12x8 in. 12 ins. in ground on S slope, on N side of a small ravine for 1/4 Sec. Cor. marked 1/4 on east face.

A pine 24 ins. dia. brs. N57°E, 56 lks dist. marked 1/4 S BT.

No tree West, raised a mound of stone alongside.

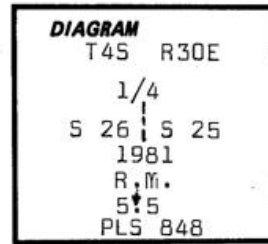

T-21

Description of corner evidence found:

No evidence found.

No bearing tree evidence found. Proportion position falls on North edge of a small ravine as per original notes; therefore, I accepted the proportion position as the 1/4 corner location.

Description of monument and accessories established to perpetuate the original location of this corner:

Corner falls on North edge of dry drainage channel. At corner position, set 24"x3/4" steel pin, flush with ground. At a point North 5.5 ft. from corner pin, set 3"x30" galv. iron pipe with 3" brass cap stamped as shown on the diagram; set 16 inches in the ground and raised a mound of stone around the pipe.

New bearing trees, referencing true corner position (24"x3/4" steel pin):

A pine 14 inches dia. bears S45°W, 33.7 ft. scribed 1/4 S 26 BT.

A pine 10 inches dia. bears N27°E, 55.3 ft. scribed 1/4 S 25 BT.

Nailed bearing tree signs and brass washers stamped PLS 848 to each tree. Painted red band around each tree.

I hereby certify that the above corner monument was reestablished as herein described on 7/30/81.



Witnesses:)
D. Mitchell Ferguson

Mike Woodward

Office of..... Co. Surveyor..... County of..... Umatilla.....

State of... Oregon..... I hereby certify that the within instrument was filed in this office

for record on the... 7th day of... January..... 1982

..... David H. Quinn..... by Betty Shatto.....

(COUNTY OFFICIAL)

(DEPUTY)

82-01-C

T-2