


INDEX No. R-23

History of original corner establishment:

This corner was originally established George Pershin, in 1881, under GLO Contract No. 390. Surveyor General Field Notes state:

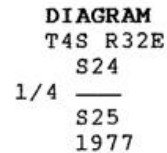

Set a basalt stone 15x12x5 on slight west slope for 1/4 sec. cor.

(BLM Cap)

A Pine 8 in. dia. brs. N16°E, 114 lks. dist.
 A Pine 22 in. dia. brs. S58°E, 26 lks. dist.

In 1977 the Bureau of Land Management (BLM) conducted a remonumentation of certain original corner points in T.4S., R.32E., W.M., under Special Instructions dated May 3, 1957, Group 350. Their record states:

The 1/4 sec. cor. of secs. 24 and 25, monumented with the original unmarked basalt stone, 15x12x5 ins., firmly set 6 ins. in the ground, and in a mound of stone, 3 ft. base, 1 ft. high, from which the remains of the original bearing trees: A pine snag, 20 ins. diam., bears N16°E, 114 lks. dist., with healed blaze. A pine snag, 32 ins. diam., bears S58°E, 26 lks. dist., with scribe mark S visible on open blaze. At the corner point set an iron post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, and in a mound of stone, 3 ft. base, to top, with brass cap mkd. (SEE DIAGRAM) from which new bearing trees: A lodgepole pine, 18 ins. diam., bears S48°E, 68 lks. dist., mkd. 1/4 S24 BT. A lodgepole pine, 13 ins. diam., bears S43°E, 127 lks. dist., mkd. 1/4 S25 BT. Deposit corner stone alongside iron post.

Description of Corner Evidence Found:

Found iron monument, in a mound of stone, with a brass cap marked as shown in DIAGRAM. Monument is solid and firm.

Ponderosa Pine snag, 24" dia., with healed blaze, bears N17°34'E, 74.8 ft. (Orig. Rec: N16°E, 75.24 ft.)

Ponderosa Pine snag, 28" dia., down w/scribing, bears S59°32'E. 15.8 ft. (Orig. Rec: S58°E, 17.16 ft)

Ponderosa Pine, 14" dia., scribed 1/4 S25 BT, bears S44°13'E, 135.9 ft. (BLM Rec: S43°E, 83.82 ft)

Ponderosa Pine, 16" dia., scribed 1/4 S24 BT, bears N47°25'E, 44.6 ft. (BLM Rec: N48°E, 44.88 ft.)

Description of monument and accessories I established to perpetuate the original location of this corner:

No work is needed on the monument.

From Which:

5/8" x 30" rebar, set approximately 28 ins. in ground, with yellow plastic cap marked PLS 2405 bears:

S58°45'W, 8.9 ft. (No groove on rebar)
 N44°30'W, 9.8 ft. (1 groove on rebar)

Measurements to rebars taken with a magnetic compass, declination 20° East, and a nylon clad steel tape. Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs 5' north and south of the monument.

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Susan E. Newstetter

OREGON
 JULY 25, 1909
 SUSAN E. NEWSTETTER
 2405

Renewed Date: 12/31/96

This work was performed by:
 Susan E. Newstetter PLS 2405
 Witnessed by: Rick Saul and
 Rick Pewonka
 October 17, 1994

RECEIVED BY

Umatilla County Surveyor

Date 1-95

Rec'd By SK

No. 95-15-B

Office of _____ County of _____
 State of _____ I hereby certify that the within instrument was
 filed in this office for record on the _____ day of _____, 19____
 by _____

(COUNTY OFFICIAL)

(DEPUTY)

R-23