

OREGON CORNER RESTORATION FORM

SECTION 13, 18, 19, 24 TOWNSHIP 5 NORTH RANGE 29 EAST, RANGE 28 EAST N-1
COUNTY : UMATILLA DATE DEC/22

CORNER DESIGNATION
SECTION CORNER

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNCOVERED
 SURVEYED IN
 REFERENCED


PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101, HE SET POST AND MADE MOUND.
IN 1988 LS 951 SET A 2 2/8" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 2 3/8" BRASS CAP STAMPED AS BELOW.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 59°05'11" E, 59.69'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 66°51'07" W, 45.61'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 47°43'31" W, 34.05'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 12°13'06" E, 52.00'.

MONUMENT DETAIL

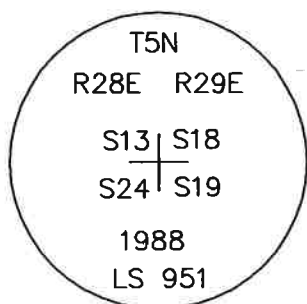

NAD 83/91
OREGON STATE PLANE
INTERNATIONAL FEET

819576.96
8521601.66

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

FROM INTERSECTION OF CRAIG ROAD
AND HIGHWAY 730 GO WEST +/- 1
MILE. CORNER FALLS SOUTH OF
HIGHWAY 730 +/- 500 FEET.

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322
HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Brit L. Primm
OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24