

OREGON CORNER RESTORATION FORM

SECTION 16 TOWNSHIP 5N RANGE 29E N-9

COUNTY: UMATILLA DATE 7/91

CORNER DESIGNATION

SW Corner

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNRECORDED
 SURVEYED IN
 REFERENCED OUT


PREVIOUS RENEWALS/SURVEYS, ETC.

Originally surveyed in 1861 by Davenport under Contract #101. He set post, made mound and drove charred stake.

MONUMENTS & ACCESSORIES FOUND: Condition and Source
Nothing found.

MONUMENT DETAIL

SKETCH

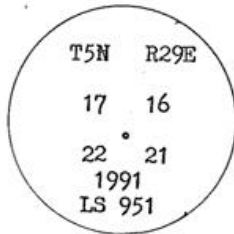

MONUMENT SET (PROCEDURES AND DESCRIPTION)

By double proportion I set 1" x 30" Iron pipe with 2 3/8" Brass Cap, stamped as above, 3" above surface and placed an 18" diameter ring of stone around. (Drove steel fence post with witness sign 3' South.) See Co. Survey #91-058-B.

NEW ACCESSORIES From which

- A 3 3/4" B.C. BM on 3" Iron pipe 1.7' above surface Bears N18° 41'E 19.08 feet,
- A 3" carpenter's nail in a 6' high rock face Bears N89° 15' 07"E 60.21 feet,
- A 6" bridge spike driven in rock crevice Bears N88° 49' 46"W 18.29 ft,
- A 1" bolt in an 8" conc. mon. Bears S0° 06' 49"E 1548.21 feet.

LOCATION & COMMENTS

From intersection of Craig Rd. with U.S. Hwy #730, go East on 730 1.0 mile to a fence corner on North R/W. Go North along fence 1550 feet. Corner lies 20' ± West of fence line.

COMPASS DEC.
FIRM EDWARDS SURVEYING
P.O. BOX 763, HERMISTON,
OREGON, 97838
PARTY CHIEF D. EDWARDS
NOTES
WITNESS S. BENEFIT

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

G. Dennis Edwards

OREGON
JULY 18, 1971
G. DENNIS EDWARDS
951

RECEIVED BY
Umatilla County Surveyor
Date 10-91
Rec'd By [Signature]
No. 91-84-R