

OREGON CORNER RESTORATION FORM

SECTION 21 TOWNSHIP 5N RANGE 29E R-11

COUNTY: UMATILLA DATE 7/91

CORNER DESIGNATION

South 1/4 Corner

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNRECORDED
 SURVEYED IN
 REFERENCED OUT

PREVIOUS RENEWALS/SURVEYS, ETC.


Originally surveyed in 1861 by Davenport under Contract #101. He set post, made mound and drove charred stake.

MONUMENTS & ACCESSORIES FOUND: Condition and Source

Found 5/8" rebar 5" below surface of graveled road which I had driven inside a 2" dia. Iron pipe 2 feet below surface in a 1980 survey for Nash and believe was set by Kimbrell around 1910-1913.

MONUMENT DETAIL

SKETCH

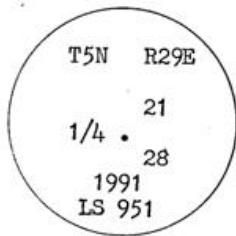

MONUMENT SET (PROCEDURES AND DESCRIPTION)

Dug down 8" below top of rebar, poured 4 1/2" diameter cylinder on conc. and placed a 2 3/8" B.C. with 1" x 3" Iron pipe over the rebar in conc. stamped as above. See Co. Survey #91-058-B.

NEW ACCESSORIES From which

An Alum. tag #951 in Power pole Bears. N34° 07'W 32.73 ft. with B.O. sign,
An Alum tag #951 in RR tie fence post Bears. N22° 32'W 20.74 ft. attached with Bearing Object sign and Witness sign,
An Alum. tag #951 in RR tie fence post Bears. S80° 12'E 76.00 ft. with Bearing Object sign attached,
Center of 6" square Telephone box Bears. S15° 28'W 67.55 feet.

LOCATION & COMMENTS

At intersection of Golda Road and Progress Road.

SURVEYOR'S SEAL

COMPASS DEC.
FIRM EDWARDS SURVEYING
P.O. BOX 763, HERMISTON,
OREGON, 97838
PARTY CHIEF D. EDWARDS
NOTES
WITNESS S. BENEFIT

REGISTERED
PROFESSIONAL
LAND SURVEYOR

J. Dennis Edward

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951

RECEIVED BY

Umatilla County Surveyor

Date 10-26

Rec'd By JK

No. 91-85-R