

OREGON CORNER RESTORATION FORM

SECTION 35, 36 TOWNSHIP 5 NORTH RANGE 29 EAST

X-21

COUNTY : UMATILLA DATE DEC/22

CORNER DESIGNATION

1/4 CORNER

CONDITION REPORT ONLY

NOT FOUND

RENEWED

UNCOVERED

SURVEYED IN

REFERENCED


PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101, HE SET POST AND MADE MOUND.
IN 2005 LS 951 SET A 2 3/8" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 2 3/8" BRASS CAP STAMPED AS BELOW.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 62°41'09" W, 135.21'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 17°41'03" W, 322.73'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 06°36'53" W, 1407.51'.
FOUND 5/8" IRON ROD WITH PLASTIC CAP STAMPED PLS 1106 BEARS N 00°15'00" W, 1325.90'.

MONUMENT DETAIL

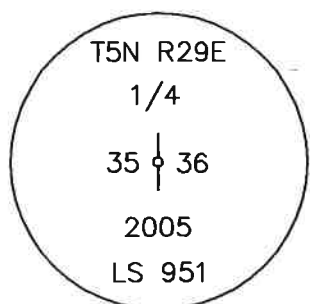

NAD 83/91
OREGON STATE PLANE
INTERNATIONAL FEET

806761.96
8548308.32

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

FROM EAST-WEST WALLS ROAD TO WHERE WALLS ROAD ANGLES AND GOES NORTHEAST. GO SOUTH +/- 0.5 MILES TO CORNER. CORNER FALLS SOUTH +/- 300 FEET FROM NORTH EDGE OF TREES.

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322
HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Brit L. Primm
OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24