

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 01/11/05

CORNER DESIGNATION: 5N35, P-21, The West quarter corner of Section 24.

PREVIOUS RENEWALS/SURVEYS ETC.:

Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post Cor. Drove charred stake; dug pits; raised mound, as per instructions.

In Record of Private Surveys, Survey No. 5, this corner was recovered and remonumented by building mound and digging pits.

Survey No. P-114-B calls for a 2" pipe and 2' x 2' stone. State Highway Map 88-11-21 calls for a "iron pipe".

MONUMENT AND ACCESSORIES FOUND:

Found and held a 2 3/8" outside diameter iron pipe protruding 24" above ground level in fence line running North 04° West and South 04° East. The pipe monument is set in concrete.

MONUMENT MARKING DETAIL: The monument is a 2 3/8" o.d. pipe, set in concrete.

New accessories:

A 5/8" x 24" rebar with a yellow plastic cap marked "OR PLS 1106, WA PLS 17372", flush with the ground, in fence line, bears South 04° East, a distance of 33.1 feet.

A 5/8" x 24" rebar with a yellow plastic cap marked "OR PLS 1106, WA PLS 17372", flush with the ground, in fence line, bears South 04° East, a distance of 53.3 feet.

A 5/8" x 24" rebar with a yellow plastic cap marked "OR PLS 1106, WA PLS 17372", flush with the ground, in fence line, bears North 04° West, a distance of 25.3 feet.

A 5/8" x 24" rebar with a yellow plastic cap marked "OR PLS 1106, WA PLS 17372", flush with the ground, in fence line, bears North 04° West, a distance of 55.0 feet.

Attached bearing object signs to all rebar accessories. Attached "witness" sign to railroad tie with H-brace which is 1 foot North of corner monument.

LOCATION AND COMMENTS:

Corner is in fence line running North 04° West-South 04° East. It is approximately 12 feet South of a field line running East.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 819869.21

E = 8738726.28

FIRM: William R. Wells, PLS

P.O. Box 1696

Pendleton, OR 97801



COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

Brian Cole

/5N35P21

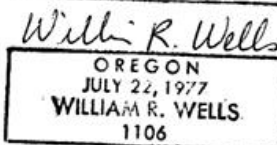

Renews 6/30/06

05-112-C