

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla DATE: 01/13/05

CORNER DESIGNATION: 5N35, X-21, The East quarter corner of Section 35.

**PREVIOUS RENEWALS/SURVEYS ETC.:**

Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post Cor. Drove charred stake; dug pits; raised mound as per instructions.

State Highway map No. 88-11-21, circa 1958, calls for a "fence corner".

**MONUMENT AND ACCESSORIES FOUND:**

An unmarked bent 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe with top 2" above ground level, in a 3 1/2' dia. mound of stones at field intersection with field berms North, East and South. There is no record of establishment for this brass cap monument.

**MONUMENT MARKING DETAIL:**

T5N R35E  
1/4  
S35 | S36  
2005  
PLS 1106

**MONUMENT SET:**

I accept the found brass cap monument as best remaining evidence of original corner location. The monument position fits well with existing field lines approaching the corner area. Dug out and straightened brass cap monument and stamped it as shown in Monument Marking Detail.

**New accessories:**

A silver deep-1 magnet buried 24" in ground bears North 46° East, 43.2 feet.  
A purple deep-1 magnet buried 24" in ground bears South 50° East, 42.7 feet.  
A blue deep-1 magnet buried 24" in ground bears South 42° West, 45.6 feet.  
An orange deep-1 magnet buried 24" in ground bears North 52° West, 48.7 feet.  
Buried bearing object signs with deep 1 magnets. Set steel fence posts with "witness" signs attached 1 foot North and 2 feet South of corner monument.

LOCATION AND COMMENTS: Corner is at intersection of field berms North-South and East.

**OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:**

N = 809049.48  
E = 8739106.95


FIRM: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT  
Brian Cole

/5N35NX21

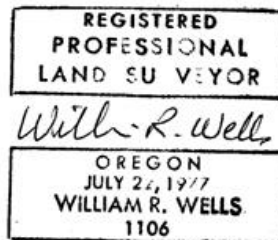

Renews 6/30/06