


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. C-9a

History of original corner establishment: In 1872, under G.L.O. Contract No. 176, George Williams set post for 1/4 cor. between secs 4 & 5 from which A yew 5 in. dia. bears E. 41 lks (27.1'). A yew 8" dia. bears S21° W 38 lks (25.1'). In 1899 a resurvey was performed by George R. & William E. Campbell under G.L.O. Contract No. 699. They found the post and witnessed and marked as before described.

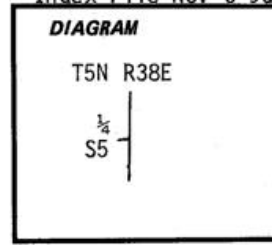


Description of corner evidence found: A diligent search was made and no evidence of the original post or BT's could be found.

Description of monument and accessories I established to perpetuate the original location of this corner: At surveyed point set 1"x30" galvanized pipe with 3" brass cap stamped: Set pipe 23" in ground with mound of stone and dirt to cap.

Bearing Trees

A Blue Spruce 7" dia. bears N24° W, 444 ft. scribed 1/4 S5 BT
A Blue Spruce 8" dia. bears S76° W, 25.5 ft. scribed 1/4 S5 BT
Attached 54-3 and 54-4 signs to both BT's. Painted 6" band around both BT's red. Attached brass washer stamped LS 1294 to foot blaze of both BT's.

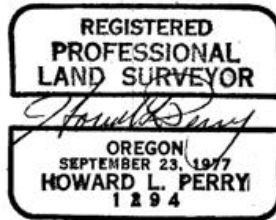

I hereby certify the above corner monument was re-established as herein described on Sept. 18, 1980

Witnesses: R. Orton
M. Wagoner

Office of..... County Surveyor..... County of..... Umatilla
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of..... December....., 1980
David Krumbein by Betty Shatto
(COUNTY OFFICIAL) (DEPUTY)