

USDA-FOREST SERVICE

Index File No. G-13

CORNER RECORD (SEARCH)
(Ref. FSM 7151.4)

Tract or Survey No. _____ Cor. No. _____

T 5N R. 38E


R.D. W² County UMATILLA

Merid. Will.

N.F. UMATILLA State OREGON

CORNER DIAGRAM

T5N R38E

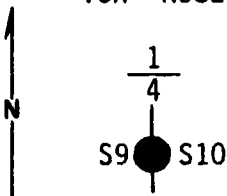

Description of corner evidence found:

Rotted stump of original Fir corner tree flush with ground, dia. approx. 18" to 20". No marks remaining from which:

A Fir 24" dia. now a 28" shattered stump approx. 3' tall with visible scribing "1/4 BT" on partially healed face bears S24°E 37.9 ft. No evidence of original NW BT.

PHOTO IDENTIFICATION DATA

Photo No. _____

Filed At. _____

Object Ident. _____

Ident. By _____

Signature

PLANE COORDINATE POSITION DATA

State _____ Zone _____

X _____

Y _____

Estab. By _____

Agency

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Signature

Title

Division

Headquarters

Date

7100-52 (3-68)

HOWARD L. PERRY

PLS 1294

10/80

CORNER RECORD (PERPETUATION)

Description of monument and accessories I established to perpetuate the original location of this corner:

Set in place of 24" tree a 1"x30" pipe with 3" brass cap stamped:

Set pipe 24" in ground with mound of stones to cap.

From which:

A Fir 16" dia. bears S69°E 14.0 ft., scribed: 1/4 S10 BT.

A Fir 13" dia. bears N11°W 26.1 ft., scribed: 1/4 S9 BT.

Attached 54-4 and 54-3 signs to both BTs. Attached brass washers stamped LS 1294 to foot blaze of both BTs. Painted blazes and 6" band around both BTs red.

CROWN ZELLERBACH

T5N 1 R38E

1/4

S9 S10

1980

OR PLS 129A

Work Done By _____ Title _____ Date _____ State Registration No. or Agency _____

Certified Cor. Record Prepared? Yes No Filed At: _____ Date _____

REMARKS

Index File No. T. R. M. Tract or Surv. No. Cor. 12
13

G-13 5N 38E

9/10
1/4

TSN E38E

G-13

1899 ORIGINAL SURVEY BY CAMPBELL

FD: ROTTED STUMP OF ORIGINAL FIR CORNER
TREE, ~~SIZE NOW IN~~ FLUSH WITH THE
GROUND, DIAMETER APPROX. 18-20", NO MARKS
REMAINING, FROM WHICH:

AN ORIG. 24" FIR, NOW A 28" SHATTERED
STUMP APPROX THREE FEET TALL WITH SCRIBING
"1/4 BT" VISIBLE ON PARTIALLY HEALED FACE
BEARS S 24° E 37² FT. (REC. S 24° E 54 LKS.)

NO EVIDENCE REMAINS OF THE ORIG. NW
BEARING TREE.

CORNER IS LOCATED ON A STEEP, HEAVILY TIMBERED
SW SLOPE APPROX. 150 FT NE OF A
STREAM, COURSE SE.

5-20-80

Mary Laughton ORLS 1099
GREG ORTON

COMPASS DECLINATION: 19 1/2° EAST.

(OVER)

ACCESS TO AND VISIBILITY FROM CORNER
LOCATION IS POOR. BEST APPROACHED FROM
RIDGE NNE OF CORNER. FOLLOW RED FLAGGING,
FROM END OF LOGGING ROAD NNW OF CORNER
APPROX. 800 FT SE ALONG RIDGETOP, THEN
BEAR SSW APPROX. 700 FT. DOWN STEEP SW
SLOPE TO CORNER.