


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Refer to PLAT OF 1989 SURVEY FOR LOUISIANA-PACIFIC CORP.  
NW 1/4 Section 12, T.5S., R.30E., W.M.

F-21

History of original corner establishment:  
No record of previous monumentation.

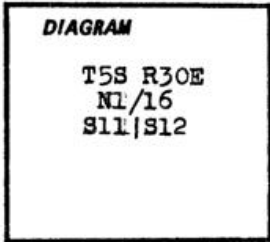

Description of corner evidence found:  
None.

Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point established by measurement, I set a 2 1/2" x 30" alum. pipe with a 2 1/2" alum. cap marked: Monument is 8" in the ground and surrounded by a mound of stone.

N1/16  
S11/S12  
PLS 1832  
1989

From the corner:

A Ponderosa Pine, 13" dia., N34 3/4°W, 84.0 ft.; marked: N1/16 S11 BT  
A Ponderosa Pine, 9" dia., East, 84.9 ft.; marked: N1/16 S12 BT

BTs have blaze and a 6" band painted red, BT tags, "Land Survey Monument" signs and alum. "PLS 1832" washers nailed to the bottom of the blaze. There is a 6' steel fence post with a "Land Survey Monument" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 18°E.

May 28, 1989



Office of..... County of.....  
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....  
..... by .....

(COUNTY OFFICIAL)

(DEPUTY)

RECEIVED BY

Umatilla County Surveyor OFSPO-780-278  
Date 12-89  
Rec'd by KA  
No. 89-115-A