


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in 1883 by F. W. Campbell under General Land Office Contract No. 468.

Surveyor General Record States:

Set basalt stone, 15 x 10 x 8 ins. for  $\frac{1}{4}$  cor. marked  $\frac{1}{4}$  on W face. From which:

A 5" Pine bears S 78 W, 222 lks.  
Dug pits, 18 x 18 x 12 ins. N & S of stone.  
Raised mound of earth along side.

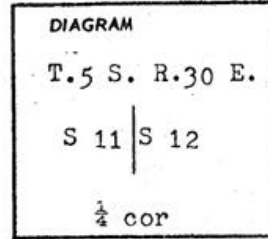

No record of subsequent remonumentation was found in County Records.

Description of corner evidence found:

Found original stone, call size marked  $\frac{1}{4}$  in remains of an old fence jack 4 ft. NE of corner position.

Found original BT and located corner from same as follows:

A 12" Pine, good condition, bears S78W, 146.5 ft., scribes visable.

Description of monument and accessories I established to perpetuate the original location of this corner

At corner point, based on BT, I set  $2\frac{1}{2}$ "x30" iron pipe with brass cap marked as shown, 20" in ground, raised mound of stone 7 ft. at base to top of cap, from which:

New BT


A 12" Pine bears S21E, 81.1 ft. marked  $\frac{1}{4}$ S12 T5S R30E BT.

Nailed brass washer in BT blaze.  
Buried original stone North and along side pipe.  
Set steel fence post 5+ ft. North of corner.  
Used steel tape and magnetic compass with 20° E declination.  
Measured to face of blaze on original BT and center of new BT.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Duane J. Griffith*

OREGON  
JULY 10, 1934  
DUANE J. GRIFFITH  
644

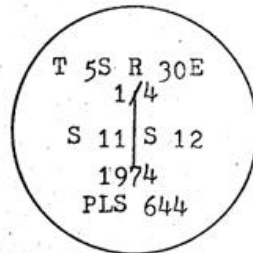

Office of Surveyor County of Umatilla  
State of Oregon, I hereby certify that the within instrument was filed in this office  
for record on the 13 day of Aug, 1974, at        o'clock        m., (signed)  
Ralph J. Brantson by         
(COUNTY OFFICIAL) (DEPUTY)

G-24

I-118-R